

Operator SWR Operating Co.
 Well Shugart #1
 Unit 0 Section 33 Township 18 Range 31
 API # 30-015-05670

TOPS

T. Salt 900
 B. Salt 2200
 Yates 2390
 Glorieta _____
 Delaware _____
 Bone Sp. _____
 Abo _____
 Wolfcamp _____
 Morrow _____
 Devonian _____
 Fusselman _____
 Other _____

← Perf 8" 5 1/2" CSG @ 60'-
 Place 60' of cm. 0-60' inside & outside
 of Both strings

686
 TOC
 @ 50%

8" 875'
 60 SK

← Place 100' of cmnt. inside & outside
 of CSG 825-925' - TAG

← Perf CSG @ 925'

← Place 100' of cmnt. inside & outside of CSG - TAG
 2200'-2300' -

← Perf CSG @ 2300'

2467
 TOC @ 50%

← Place 35' of cmnt on CIAP

2330 CIAP - 9-30-82

2739
 3366
 + Perfs

5 1/2" 3420'
 250 SK

- Contact OCD 24 hrs. prior to any work done
- Salt gel mud consisting of 10# brine with 25 of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.