	Operator SWR Oferating Co	TOPS
	Well Mickson 1 1	T. Salt 847
	Unit D Section 4 Township 19 Range 31	B. Salt 2185
	API # 30-0 15 05731	Yates 2460
	AFT# 30-013 03+31	
		Glorieta
		Delaware
		Bone Sp.
		Abo
		Wolfcamp
	4	Morrow
]		Devonian
1		
	1 Pul 89/8 15/2 CAS. @ 60 place 60 of	Fusselman
	Cont- 0'-60' inside ! outside of both strings of cog.	Other
f	my by man of the	
	both strings of any.	
		• Contact OCD 24 hrs. prior to any work done
1	'	• Salt gel mud consisting of 10# brine with 25
- 1	•	of gel per barrel must be placed between eac
		_
		plug
1	-	• Install dry hole marker as per rule 202.B.2
, 001		• Plugs are to be set from point indicated up.
692		Plugs must not be less than 100' or 25 Sacks
10C		of cement, whichever is greater, unless
Too a	Flace 100' of emt 800'- 900'- inside ? Autside Ful cog @ 900'	specifically indicated.
9"	Place 100 of cont 800 - 900 - 105,000; Ourside	• Shoe and stub plugs will be 50' above and
	of, esq. 749	below shoot are stub and togged
88 850		below shoe or stub and tagged.
0000	K Papess @ 900'	 Surface plug will be from 0'- 60'
2025		• Where plugs are required cement must be
	·	placed inside and outside of all casing
		string(s), in the correct footage or sacks
		required, if no cement exists.
	L Place 100' of cmt 2300 2400 inside & Outside of Csq Tag L Perf Csq @ 2400	 Plugs to be tagged will be indicated.
	Outside of Csy TA9	
	1 P. 1 150 @ 2400	
	129 cs 1 C 5 400	•
2701	TOC @ 50%	
276	TOC@ 50%	
-		
	1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	
_	← 25 5× plug @ 3323 725	
1111 00	12	
51/2" 32	i	
12	ISSX OH 3273-	
	3589	•