

Operator SWR Operating Co. -
 Well Leathersto - Fed #1
 Unit J Section 4 Township 19 Range 31
 API # 30-015 -- 05732

TOPS

T. Salt 975
 B. Salt 2190
 Yates 2500
 Glorieta _____
 Delaware _____
 Bone Sp. _____
 Abo _____
 Wolfcamp _____
 Morrow _____
 Devonian _____
 Fusselman _____
 Other _____

← Perf csq @ 60' - Circ cmt in? outside
 0'-60'

← Place 100' of cmt. 220-320 inside &
 outside of csq. - TAG

← Perf csq @ 320'

← Place 100' of cmt 675-775' inside &
 outside of csq. - TAG

← Perf csq @ 975'

← Place 100' of cmt 2200-2300' inside &
 outside of csq. - TAG

← Perf csq @ 2300'

← TOC - calc @ 50%.

← 25 sx Plug @ 3300' - TAG

← Perfs

3448

195 sx

- Contact OCD 24 hrs. prior to any work done
- Salt gel mud consisting of 10# brine with 2% of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sack of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.