

Operator SWB Operating Co. -
Well Featherston - Fed "A" #1
Unit H Section 5 Township 19 Range 31
API # 30-015-05737

TOPS

T. Salt 841
B. Salt 2150
Yates 2450
Glorieta _____
Delaware _____
Bone Sp. _____
Abo _____
Wolfcamp _____
Morrow _____
Devonian _____
Fusselman _____
Other _____

← Perf csq. @ 60' circ cmt 0'-60'

← Place 100' of cmt inside & outside of csq. 218'-318' - TAG

← Perf csq @ 318'

← Place 100' of cmt inside & outside of csq. 740'-840' - TAG

← Perf csq @ 840'

← Place 100' of cmt inside & outside of csq. 2200'-2300' - TAG

← Perf csq @ 2300'

2842 — TOC @ 50%

← 255x plug @ 2300' - TAG

3316-3328 — Refs

4 1/2" 3350
1.755x
7 1/8" hole

- Contact OCD 24 hrs. prior to any work done.
- Salt gel mud consisting of 10# brine with 2% of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.