

N. M. & C. C. COPY  
UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY  
SUBMIT IN TRIPlicate  
(Other instructions re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.5. LEASE DESIGNATION AND SERIAL NO.  
029387(c)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Kerwood Federal

9. WELL NO.

1-Y

10. FIELD AND POOL, OR WILDCAT

Shugart

11. SEC., T., R., M., OR BLE. AND  
SURVEY OR AREA

Sec. 29-18S-31E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

RECEIVED

APR 23 1976

O. C. C.  
ARTESIA, OFFICE1. OIL ☒ GAS ☐  
WELL WELL OTHER

2. NAME OF OPERATOR

Shenandoah Oil Corporation ✓

3. ADDRESS OF OPERATOR

1500 Commerce Building - Fort Worth, Texas - 76102

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

Unit "E"

2310' FWL and 360' FWL Section 29 -18S - 31E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

N. K.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐  
☐  
☐  
☒

PULL OR ALTER CASING

☐  
☐  
☐  
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANS

(Other)

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐  
☐  
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

☐  
☐  
☐(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any  
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-  
nent to this work.)\*

3,795' P.B.T.D.

3,839' T.D.

5-1/2" @ 3,835' w/175 sks

Tubing stuck in hole. Suspect small hole in casing w/salt and oyp build-up sticking tubing.

1. Pull rods.
2. Attempt to work tubing loose. If unsuccessful, will run "free point" and cut off tubing and attempt to jar out of hole. If this fails, will wash over tubing and fish tubing out of hole.
3. Check for hole in casing w/packer and plug. Repair hole in casing by cementing as necessary.
4. Drill out cement. Test casing.
5. Run tubing and rods and put well back on production.

RECEIVED  
APR 22 1976  
U. S. GEOLOGICAL SURVEY  
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

C. W. Downey, Jr.

(This space for Federal or State office use)

TITLE Operations Superintendent

DATE April 20, 1976

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

\*See Instructions on Reverse Side