

DRILLING, CASING, AND CEMENTING PROGRAM (Cont'd.):

10. Cement with sufficient 50-50 Pozmix S cement with 0.4% HR-4 to cover 1000' above pay zone. Tail in with enough Latex cement to cover 100' above pay zone. Use 2 sx of lime in 10 bbls. water ahead of cement. Add 2 sx sodium bichromate to mud system prior to running casing. Be sure paddle mixer is available for mixing latex cement.
11. If float holds, land casing as cemented, release pressure immediately, nipple up, WOC 8 hrs., run temperature survey, and release rig.