

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

STAMP IN LEFT
(Other instruction
verse side)

Expires August 31, 1985
5. LEASE DESIGNATION AND SERIAL NO.
NM-0557148 (SW274) d/sf
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different zone.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ SEP-13 '90

2. NAME OF OPERATOR
Damson Oil Corporation ✓

3. ADDRESS OF OPERATOR
3300 N. A, Building 8, Suite 100, Midland, Texas 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

Unit G, 1980' FNL and 1980' FEL
Section 14, T-19-S, R-31-E

14. PERMIT NO.
N/A

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
3535.4 GR

12. COUNTY OR PARISH
Eddy

13. STATE
New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Cite all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. NU BOP
2. Spotted 50 sack cement plug at 11,084', WOC, plug not there.
3. RIH with 4 1/2" packer to 7402' and squeezed 150 sack plug.
4. Cut and pulled 4 1/2" casing from 6650'.
5. Spot 30 sack plug at 6650', WOC, tagged at 6603'.
6. Spot 40 sack plug at 4061', WOC, tagged at 3971'.
7. Cut and pulled 20 jts. 8 5/8" from 600'.
8. RIH and spot 60 sack plug at 700', WOC, tagged at 687'.
9. Pumped 60 sack plug at 687', WOC, tagged at 620'.
10. Pumped 30 sack plug, WOC, tagged plug at 600'.
11. Pumped 60 sack plug at 600', WOC, tagged plug at 488'.
12. Pump 35 sack surface plug.
13. Set dry hole marker.

WITNESSED BY: DALE CARPENTER OF B.L.M.

P & A Complete 5/7/90

18. I hereby certify that the foregoing is true and correct

SIGNED Donald R. Cray

TITLE District Engineer

DATE May 14, 1990

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE 9-11-90

Post ID-2
9-21-90
P & A

cc: AWH, JB

*See Instructions on Reverse Side