

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRICATE*
(Other instruct on
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 064877-F

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR C. W. Trainer	8. FARM OR LEASE NAME Joyce
3. ADDRESS OF OPERATOR P. O. Box 1100, Hobbs, New Mexico	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FNL & 660' FWL Sec. 12-19S-31E	10. FIELD AND POOL, OR WILDCAT 2nd Shugart Queen
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 12-19S-31E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3611.8 GL	12. COUNTY OR PARISH Eddy
	13. STATE New Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well was plugged and abandoned as follows:

1. Spotted 35 sx. cement plug in 4 1/2" casing across perfs 3463-3506.
2. Shot 4 1/2" at 2440', 2366' & 2335' and pulled 2335'.
3. Spotted 35 sx. cement plug in and out of 4 1/2" casing stub.
4. Shot 8 5/8" at 2314' & 2281' and pulled 2281'.
5. Spotted 35 sx. cement plug in and out of 8 5/8" casing stub.
6. Spotted 35 sx. cement plug 675' - 750' (in and out of 11 3/4" pipe).
7. Set regulation 4" pipe marker in 10 sx. cement in top of 11 3/4" casing.
8. Clean and level wellsite and tank battery site.

This work has all been done except hauling away 2 tanks and the heater.
Plan to finish clean up right away.

RECEIVED

OCT 2 1967

U.S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICORECEIVED
JUL 3 1967
U.S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

C. W. Trainer

TITLE

Owner - Operator

DATE June 30, 1967

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

APPROVED
OCT - 2 1967
R. L. DECKMAN
ACTING DISTRICT ENGINEER

*See Instructions on Reverse Side