

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87501-2088

OCT 20 1993

WELL API NO. 30-015-20114
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Nicholas BJ
8. Well No. 1
9. Pool name or Wildcat Penasco Draw San Andres Yeso

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator YATES PETROLEUM CORPORATION
3. Address of Operator 105 South Fourth Street - Artesia, NM 88210

4. Well Location Unit Letter <u>I</u> : <u>2310</u> Feet From The <u>South</u> Line and <u>330</u> Feet From The <u>East</u> Line Section <u>5</u> Township <u>19S</u> Range <u>25E</u> NMPM <u>Eddy</u> County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3563' GR
---	--

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon well as follows:

Notify N.M.O.C.C. in sufficient time to witness

1. Pull rods, pump and tubing.
2. Run 2-3/8" tubing to TD (1858').
3. Load hole with 10#/gallon brine containing 25#/barrel salt gel.
4. Set a 25 sack Class "C" 2% CaCl<sub>2</sub> plug from ~~1530-1113'~~ (across perforations). 1550-1085'
5. Pull tubing to 1000' and circulate hole clean.
6. WOC 4 hours and tag plug.
7. Set a 25 sack Class "C" plug from ~~1004-643'~~ (across 7" shoe). 1004-554'
8. Set a 25 sack Class "C" plug from ~~361'~~ to surface. 365 inside - outside 4 1/2'
9. Install regulation abandonment marker.

NOTE: NOTIFY OCD - ARTESIA (748-1483) 24 HOURS PRIOR TO COMMENCING OPERATIONS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE Oct. 19, 1993  
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505-748-1471

(This space for State Use)

APPROVED BY [Signature] TITLE Field Rep DATE 10/28/93

CONDITIONS OF APPROVAL, IF ANY: