

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

RECEIVED
NEW MEXICO OIL CONSERVATION COMMISSION

FEB 24 1972

D. C. C.
ARTESIA OFFICE

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>

5. State Oil & Gas Lease No.
L-3355

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator THE PETROLEUM CORPORATION	8. Farm or Lease Name Petco State Com.
3. Address of Operator 3303 Lee Parkway, Dallas, Texas 75219	9. Well No. 2
4. Location of Well UNIT LETTER N 660 FEET FROM THE South LINE AND 1980 FEET FROM West 26 TOWNSHIP 19 RANGE 29 NMPM.	10. Field and Pool, or Wildcat Parkway Wolfcamp
15. Elevation (Show whether DF, RT, GR, etc.) GL-3340	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Loaded hole w/gel mud.
2. Set bridge plug at 9550' & dump 8 sxs. cement on top.
3. Shot 4-1/2" casing at 5500' & pulled 5500' of 4-1/2" casing.
4. Set 50 sack cement plug 5505 to 5405 feet.
5. Set 35 sack cement plug 3850 to 3750 feet.
6. Shot 8 5/8" casing at 1012 feet and pulled 1012 feet of 8-5/8" casing.
7. Set 35 sack cement plug 1072 to 972 feet.
8. Set 35 sack cement plug 640 to 540 feet.
9. Set 10 sack cement plug at surface.

10. Installed 4 inch marker 2-14-72

Prepare to clean up location -- will advise when ready for inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNER Sandy C. Shamm TITLE Petroleum Engineer DATE Feb. 21, 1972

APPROVED BY Decker McCombs TITLE OIL AND GAS INSPECTOR DATE JUN 14 1972

CONDITIONS OF APPROVAL, IF ANY: