

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPlicate
(Other Instructions on Reverse Side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

NM-045275

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Vicki Federal

9. WELL NO.

10. FIELD AND POOL, OR WILDCAT

S. Dagger Draw, Penn
Artesia, Bone Springs

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

26-20S-24E

12. COUNTY OR PARISH 13. STATE

Eddy NM

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐

2. NAME OF OPERATOR

Conoco Inc.

3. ADDRESS OF OPERATOR

P.O. Box 460 - Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State laws or regulations.
See also space 17 below.)
At surface

1980' FNL & 1980' FFL - Unit Letter G

14. PERMIT NO.

30-015-20457

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. MIRR. if necessary kill well w/10 ppq mud.
2. G1H w/ bit, csq scraper & tbg to 3700' & tag cement retained. POOH w/tbg.
3. G1H w/tbg & cement retained. Set retained at 3474'. Pump 25 sxs class "H", 15.6 ppq cmt. Pull out of retained & pump 25 sxs class "H", 15.6 ppq cement to cap cement retained.
4. POOH to 3248'. Pump 75 bbls 10 ppq mud to circ hole full of mud.
5. POOH to 1152' & pump 25 sxs class "H", 15.6 ppq cement to isolate intermediate csq shoe. Displace w/15 bbls 10 ppq mud.
6. POOH to 524' & pump 25 sxs class "H", 15.6 ppq cmt to isolate surface shoe. Displace w/1 bbl 10 ppq mud.
7. POOH to 50' and circ 10 sxs to surface.
8. Cut off csq 3' below ground level. Install P&H marker. For further information contact Clyde Finlay at 397-5800.

18. I hereby certify that the foregoing is true and correct

SIGNED William W. Baker
William W. Baker

TITLE Administrative Supervisor

DATE April 17, 1989

(This space for Federal or State office use)

APPROVED BY [Signature]
CONDITIONS OF APPROVAL, IF ANY:

FOR: CHIEF, LAND AND RESOURCES
TITLE

DATE 5-3-89

*See Instructions on Reverse Side