

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-015-20680
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	LG-864
7. Lease Name or Unit Agreement Name	
Aparejo APA State Com	
8. Well No.	2
9. Pool name or Wildcat	Dagger Draw Upper Penn, North

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
YATES PETROLEUM CORPORATION

3. Address of Operator
105 South 4th St., Artesia, NM 88210

4. Well Location
Unit Letter F : 2080 Feet From The North Line and 1780 Feet From The West Line
Section 16 Township 19S Range 25E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3485' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Action
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	APPROPRIATE CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: Commence re-entry operations <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-25-95 - Cleaned off pad, dug out cellar and jack hammer cement out of cellar. Removed dry hole marker. Cut off 8-5/8" and weld on 11" 3000# starting head.
3-26-95 - Moved in and rigged up pulling unit. Nippled up 10" BOP. Picked up 7-7/8" bit and drilled out surface plug. Spudded at 12:15 PM 3-25-95. Tagged stringer at 110'. TIH with 10 4-3/4" drill collars and tubing. Tagged shoe plug at 1010'. Tested 8-5/8" casing to 1000 psi. Drilled out plug at 1341'. Circulated gas out. TIH to 2000' and circulated. Tagged plug #3 at 2321'. Drilled out of plug at 2435'. TIH to 3000' and circulated. TIH and washed down to 3785'. Tagged plug #4 at 3910'. Drilled out of plug at 4041'. Circulated.
3-27-95 - TIH to 4594' and circulated. TIH to 5114' and circulated. TIH and tagged plug at 5233'. Drilled down to stub at 5464'. Pumped sweep mud. Circulated clean. TOOH. TIH with 4-3/4" bit, 6 3-1/2" drill collars and tubing. Drilled cement to top of 5-1/2" casing at 5505'. Circulated clean. TOOH. TIH with 7-5/8" OD dress off mill with pilot guide. Tagged stub. Shoe went over stub. Cutting with mill.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE 3-31-95
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for State Use)

ORIGINAL SIGNED BY TIM W. GUM
DISTRICT II SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

APR 10 1995