Details of bop testSamedan Oil CorporationFannin #110/6/73Contractor:W E K Drlg.Rig 2Test by Yellow Jacket Tools and Services, Inc.



The above is a transposition of the pressure recorder charts covering test to the blowout control equipment in service on your well drilling in the Artesia Area, Hobbs District, New Mexico. Test was made with test plug landed in casing head with the following test results:

Arrived location - crew pulling Halliburton test tools.

TESTING: Blind Rams with value closed off stack on kill line and all values closed off choke-manifold cross - pressure applied thru test entry of bull plug off tee on chokeline.

- Test #1 Pressured to 3000# with loss of pressure; repressured to 3000# with loss of pressure. Volume pump went out. Replaced.
- Test #2 Repeated test. Pressured to 3000# with loss of pressure; repressured to 3000# with <u>leak to thread connection of wing value</u> <u>off manifold cross (pipe rack side</u>). Tightened.
- Test #3 Repeated test. Pressured to 3000# with loss of pressure; repressured to 3000# with loss of approximately 200# during first