


YATES PETROLEUM CORPORATION
Dee 36 SE State #1
Section 36-T19S-R24E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

6. Drill out cement plug from 7794-7855' and test 4 squeeze holes at 7855'.
7. Drill out CIBP at 7940' and pressure test DV tool at 8148'. Clean out to CIBP at 9015'. Drill on CIBP to see if there is any cement on top. TOOH.
8. GIH with bit and scraper to CIBP at 9015. Circulate hole clean.
9. Swab casing dry or unload fluid from well with nitrogen. TOOH with bit & scraper.
10. Knock out CIBP at 9015' and push below perforations 9126-9148' (Morrow).
11. TIH with packer with on/off tool and profile nipple with blanking plug on wireline and set at 9075'±.
12. TIH with tubing and overshot and latch onto packer. Load annulus and test packer. Nipple down BOP and nipple up tree. Pull blanking plug.
13. Swab/flow perforations 9126-9148' (Morrow).
14. Place well into production.



Rusty Klein
Operations Technician
December 20, 1999