

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

RECEIVED

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Dry hole	7. Unit Agreement Name
2. Name of Operator Cities Service Company	8. Farm or Lease Name State CY
3. Address of Operator P. O. Box 1919 - Midland, Texas 79702	9. Well No. 1
4. Location of Well UNIT LETTER H 1980 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 26 TOWNSHIP 19S RANGE 28E NMPM.	10. Field and Pool, or Wildcat Wildcat Bone Springs
15. Elevation (Show whether DF, RT, GR, etc.) 3362.8' GR	12. County Eddy

16.

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

O.T.D. 11375' Shale & Lime, 0 PBTD 9050'. This well was plugged and abandoned in the following manner:

1. MIRU pulling unit. Pulled tubing and packer.
2. Run in hole with tubing to 8985'. Circulate hole with mud laden fluid. Set a 100' plug (35 sacks) @ 8985-8885' across top of the Wolfcamp.
3. Set a CIBP @ 7700' and dumped 4 sacks of cement (39') on top of CIBP. POOH.
4. Run in hole with tubing to 6652' and spotted @ 100' cement plug (25 sacks) @ 6652-6552 half above and half below the top of the first Bone Springs.
5. Set tubing @ 4022' and spotted @ 100' cement plug (25 sacks) @ 4022-3922' half above and half below the top of the Bone Springs.
6. Pulled tubing to 2961' and spotted a 100' cement plug (25 sacks) @ 2961-2861' half above and half below 8 5/8" casing shoe @ 2911'.
7. Pulled tubing to 662' and spotted a 100' (25 sacks) cement plug @ 662-562' half above and half below 13 3/8" casing shoe @ 612'.
8. Dumped a 10 sack cement surface plug @ 39-0'. Installed dry hole marker to designate a plugged and abandoned location. Clear location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Elmer Startz TITLE Region Opr. Mgr. - Prod. DATE October 8, 1982

APPROVED BY Randy Brooks TITLE Geologist DATE 6-4-84

CONDITIONS OF APPROVAL, IF ANY: