

*CISF  
JP*

DISTRICT I  
P O Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

2040 Pacheco St.  
Santa Fe, NM 87505

DISTRICT II  
P O Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-015-22420
Indicate Type of Lease STATE FEE <input checked="" type="checkbox"/>
State Oil & Gas Lease No.

<p><b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>		Lease Name or Unit Agreement Name Ligett, et al Com
Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL _____ OTHER _____	Name of Operator Nearburg Producing Company	Well No. 1
Address of Operator 3300 N A St., Bldg 2, Suite 120, Midland, TX 79705	Well Location Unit Letter <u>J</u> 1980 Feet From The <u>East</u> Line and <u>1980</u> Feet From The <u>South</u> Line Section <u>6</u> Township <u>19S</u> Range <u>26E</u> NMPM <u>Eddy</u> County	Pool name or Wildcat W. Four Mile Draw Morrow
Elevation (Show whether DF, RKB, RT, GR, etc.) 3376' GR		

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	
OTHER: <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ANBANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1.) MIRU P&A rig on 01/22/01.
- 2.) Set CIBP @ 9110'. Spot 25 sx plug on top. Tagged plug. 01/23/01.
- 3.) Spot 25 sx cement plug @ 8142'.
- 4.) Spot 25 sx cement plug @ 6270' to 5940'. 01/25/01.
- 5.) Cut csg @ 4,000' & pull 4-1/2" csg. 01/27/01.
- 6.) TIH to 4157', spot 50 sx cmt plug. WOC. 01/29/01.
- 7.) Tagged top of plug @ 3844'. Spot 30 sx cmt @ 2371' to 2488'.
- 8.) Spot 35 sx cmt plug @ 1350. WOC. WOC. Tagged @ 1240'.
- 9.) Spot 35 sx cmt plug @ 360'. WOC. Tagged @ 255'. 01/30/01.
- 10.) Set 30' surface plug.
- 11.) Set dry hole marker.
- 12.) Well P&A'd. RDMO on 01/31/01. FINAL REPORT.



I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kim Stewart TITLE Regulatory Analyst DATE 02-07-01  
 TYPE OR PRINT NAME Kim Stewart TELEPHONE NO. 915/686-8235

(This space for State Use)

APPROVED BY [Signature] TITLE Field Rep ID DATE MAR 7 2002  
 CONDITIONS OF APPROVAL, IF ANY: