

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

RECEIVED CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

AUG 12 '88

O. C. D.

ARTESIA OFFICE

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. LG-4222
7. Unit Agreement Name
8. Farm or Lease Name Eddy GZ State Com.
9. Well No. 1
10. Field and Pool, or Wildcat W. Millman, Grayburg
12. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☒ OTHER ☐

Name of Operator
Steve Sell

Address of Operator
P. O. Box 5061, Midland, TX 79704

Location of Well
UNIT LETTER I, 1980 FEET FROM THE South LINE AND 660 FEET FROM
THE East LINE, SECTION 12 TOWNSHIP 19S RANGE 27E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
3521' Grd.16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 7-19 Perforate 2290'-2299' w/10 holes. Acidize with 3000 gals. 20% hot NEFE.
- 7-20 Swab well.
- 7-21 Swab well. Set CIBP at 2260'.
- 7-22 Perforate 1922', 24, 29, 32, 38, and 1941' with 6. Acidize with 1000 gals. 15% NEFE. Swab well. Perforate 1872', 76, 78, 83, 84, and 1886' w/6.
- 7-23 Acidize with 1000 gals. 15% NEFE. Swab well.
- 7-25 Swab well.
- 7-26 Swab well. Frac with 40,000 gals. of 40# gel with 300 sxs. of 20/40 and 300 sxs. of 12/20.
- 7-27 Flowing back. Run 2 3/8" production string. Begin well pumping back.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Bucky OlsonTITLE AgentDATE 8-10-88Original Signed By
Mike Williams

TITLE

DATE

AUG 29 1988

CONDITIONS OF APPROVAL, IF ANY: