

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED

JUN 14 1993

O.C.D.
ARTS & CRAFT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Kaiser-Francis Oil Company

3. Address and Telephone No.

P. O. Box 21468, Tulsa, OK 74121-1468

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FNL & 660' FEL of Sec. 18-19S-23E

5. Lease Designation and Serial No.

NM-6019

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Runyan Federal #2

9. API Well No.

30-015-22940

10. Field and Pool, or Exploratory Area

Runyan Ranch (Morrow)

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Our proposed procedure to P & A is as follows:

1. Notify BLM at 505-887-6544 prior to commencing operations.
2. Set CIBP @ 7660' w/35' cmt on top. TIH w/tbg. Load hole w/10# brine w/25# gel/bbl.
3. Set 25 sx cmt plug @ 4500'. Tag plug at no deeper than 4360'.
4. Shoot and pull 5 1/2" casing (est. 2500').
5. Set 35 sx cmt plug from 2550'-2450'. Tag plug.
6. Set 35 sx cmt plug @ 1744'. Tag plug at 1604'.
7. Perf 8 5/8" casing @ 300' w/4 holes.
8. Set packer @ 280' & establish circulation thru 8 5/8"-13 3/8" annulus.
9. TOOH w/packer and set cmt retainer @ 280'. Pump 200 sxs cmt and circ to surface.
10. Fill 8 5/8" casing to surface w/85 sxs cmt.
11. Install DH marker.

Approximate starting date is 1/20/93.

14. I hereby certify that the foregoing is true and correct

Signed

Charlotte Van Valkenburg
Technical Coordinator

Date 1/5/93

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM-6019

6. If Indian, Allottee or Tribe Name

-

7. If Unit or CA, Agreement Designation

-

8. Well Name and No.

Runyan Federal #2

9. API Well No.

n/a

10. Field and Pool, or Exploratory Area

Runyan Ranch (Morrow)

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Our proposed procedure to P & A is as follows:

1. Set CIBP @ 7660' w/35' cmt on top.
2. TIH w/tbg. Load hole w/10# brine w/25# gel/bbl.
3. Set 25 sx cmt plug @ 4500'.
4. Shoot and pull 5 1/2" casing (est. 2500').
5. Set 35 sx cmt plug from 2550'-2450'.
6. Set 35 sx cmt plug @ 1744'.
7. Set 35 sx cmt plug @ 325'.
8. Set 10 sx cmt surface plug.

Approximate starting date: 12/1/92

RECEIVED
NOV 2 10 47 AM '92
CARRIZO
AREA

RECEIVED

14. I hereby certify that the foregoing is true and correct

Signed

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Charlotte Van Valkenburg
Technical Coordinator

Date

10/28/92

Title

Date