


Operator Newburg Industries Co.  
 Well Parine #1  
 Unit I Section 23 Township 19 Range 25  
 API # 30-012-25019

TOPS

Sun Andrus 1010  
Glorieta 2400  
Box Spring 3850  
Wolfcamp 6610  
Penn 7130 Canyon 7718  
Strawn 8250  
Artica 8911  
Alameda 9142  
Clatskanie 9255  
Chester 9604

- \* Contact OCD 24 hrs. prior to any work done.
- \* Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- \* Install dry hole marker as per Rule 202.B.2
- \* Plugs are to be set from point indicated up.
- \* Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- \* Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- \* Surface plug will be from 0' - 60'
- \* Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- \* Plugs to be tagged will be indicated.

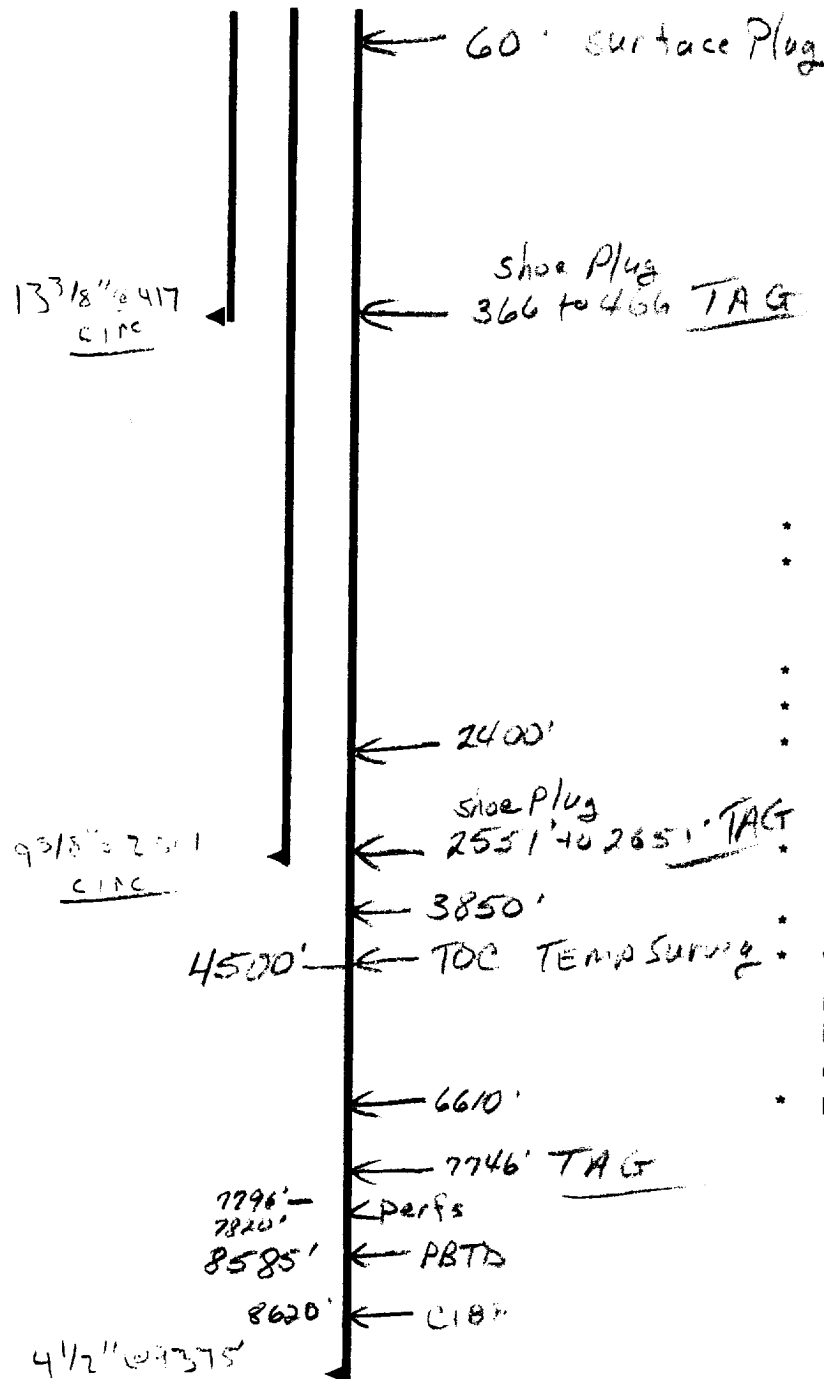

MUR