Donna Clack

TYPE OR PRINT NAME Trills space for State Use

CONDITIONS OF APPROVAL, IF ANY

505-748-1471

TELEPHONE NO.

## State of New Mexico

Energy, Minerals and Natural Resources Department DISTRICT | P.O. Box 1980, Hobbs NM 88240 OIL CONSERVATION DIVISION DISTRICT II 30-005-23257 P.O. Box 2088 P.O. Drawer DD, Artesia NM 88210 Santa Fe, New Mexico 87504-2088 DISTRICT III 5. Indicate Type of Lease 1000 Rio Brazos Rd., Aztec NM 87410 X State SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE " APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) IRISH HILLS YESO JE STATE OIL GAS X WELL WELL OTHER 2. Name of Operator Yates Petroleum Corporation 3 3. Address of Operator & Pool Name or Wildca 105 South 4th., Artesia, NM 88210 PENASCO DRAW SAN ANDRES YESO 4. Well Location 33b1 E 2310 NORTH Н Feet From The Unit Letter Feet From The Line and EAST Line Section 12 Township T19S Range R24E **NMPM EDDY** COUNTY 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3596' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PLUG AND ABANDON PERFORM REMEDIAL WORK REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS PLUG AND ABANDONMENT PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER OTHER 12. Describe Proposed or Completed Operations (Clearly state all pertient details, and give pertinenet dates, including estimated date of starting any proposed work) SEE RULE 1103. YATES PETROLEUM RESPECTFULLY REQUESTS PERMISSION TO PLUG & ABANDON AS FOLLOWS: MIRU - TOH w/ tubing RU wireline to set 4.5" CIBP A 2526'. TIH w/ tubing to tag CIBP, load hole w/ plugging mud. Dump 35' Class 'C' cement on top of CIBP Load hole w/ plugging mud. Spot a 10 sk Class 'C' w/ 2% CaCl2 plug from 883-983'; circulate clean. WOC 2-1/2 hrs and tag plug Move tubing to spot a 10 sk Class 'C' w/ 2% CaCl2 plug from 321'-421'. Pull tubing up hole & circ clean. POH; WOC 2-1/2 hrs & tag plug Spot 15 sk Class 'C' cement plug @ surface. Remove equipment & install dry hole marker per regulations. Notify OCD 24 hrs. prior to any work done Thereby certify that the info Operations Techician DATE 2-15-002 TITLE SIGNATURE