

GARRETT ENERGY, INC.

OLD CITY HALL BUILDING
222 West Fox Street
CARLSBAD, NEW MEXICO 88220
Phone (505) 887-7586

RECEIVED

JUN 12 1980

Energy and Minerals Department
Oil Conservation Division
Santa Fe, New Mexico 87501

O. C. D.
ARTESIA, OFFICE

RE: Beverly State #2, N.E. $\frac{1}{4}$ of N.E. $\frac{1}{4}$, Sec. 2, R. 19, T. 27
Eddy County, New Mexico

- 6-5-80 Move in & rig up Alta West Drilling.
- 6-6-80 Spud 12 $\frac{1}{2}$ " surf. hole @ 8:15 a.m. Mud wt. 8.5 Vis. 28
Drill to 338'. Totco $\frac{1}{4}$ deg. POOH. Ran 1-Howco guide
shoe. 1-Jt. 8 $\frac{5}{8}$ " OD 8RD 24# ST&C K 55 csg. 1-Howco
insert float. 7 Jts. csg. to surf. Total of 318' KB.
Cemented w/200 sx. Cl. "C" w/2% CaCl. Plug down @
6:30 p.m. 6-6-80. Circ. est. 10 sx. cement. Nipple
up. W.O.C. 12 $\frac{1}{2}$ hrs.
- 6-7-80 338' W.O.C. 5 $\frac{1}{2}$ hrs. (Total of 18 hrs.) Press csg.
for 30 min. Resume drilling plug & 7 $\frac{7}{8}$ " hole. Mud
wt. 8.5# Vis. 29. Totco @ 841' $\frac{3}{4}$ deg. Totco @
1315' 1 deg.
- 6-8-80 1483'. 1145' in 18 $\frac{1}{2}$ hrs. Mud wt. 8.6. Vis. 30.
Totco @ 1819' 1 deg.
- 6-9-80 1938'. 455' in 6 $\frac{1}{2}$ hrs. Mud wt. 8.5. Vis. 29. Made a
trip for bit #3. Totco @ 2012" 1 deg.
- 6-10-80 Bring mud up to 36 vis. Reach TD @ 2200' @ 2:15 A.M.
6-10-80. Circ. hole 1 hr. POOH. Ran Schlumberger
CN-FD log from 2200' to surf. Trip in hole. No fill.
POOH laying down drill pipe. Ran 1-Howco guide shoe.
1-Jt. 4 $\frac{1}{2}$ " OD 8RD 9.50# ST&C K-55 csg. 1-Howco float
collar. 55 Jts. csg. to surf. 2187' of pipe set
@ 2200' KB. Cemented w/350 sx. Howco lite w/6# salt
per sx., $\frac{1}{4}$ #, flo-cele per sx. followed w/250 sx. 50-50
Pos. w/6# salt per sx. & 2% gel, 3/10 of 1% CFR2.
Plug down @ 3:15 p.m. 6-10-80. Float held. Circ.
est. 50 sx. cement. Drop slips. Cut off csg. Weld
on head. Rel. rig @ 4:25 p.m. 6-10-80