

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

30-015-23636

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

LG-3998

7. Lease Name or Unit Agreement Name

Hogback PO State Com

8. Well No.

1

9. Pool name or Wildcat

Undesignated

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OL
WELL ☒

GAS
WELL ☐

OTHER

2. Name of Operator

YATES PETROLEUM CORPORATION

3. Address of Operator

105 South Fourth Street - Artesia, NM 88210

4. Well Location

Unit Letter C : 660 Feet From The North Line and 1980 Feet From The West Line

Section 20

Township 19S

Range 24E

NMPM

Eddy

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3764' GR

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon well as follows:

1. Nipple up BOP & TOOH with tubing.
2. Set CIBP at 6025'. Dump 35' of cement on top of CIBP.
3. Pull up to 5000' and spot a 25 sack Class C Neat plug from 5000-4630'.
4. TOOH. Set CIBP at 3725'. Dump 35' of cement on top of CIBP. Perforate 4-1/2" casing at 370' with 4 SPF. Fill casing with brine water.
5. Pull up to 1800' and spot a 25 sack Class C Neat plug from 1800-1425' (across Glorieta).
6. Pull up to 1100' and spot a 25 sack Class C Neat plug from 1100-720' (across 8-5/8" shoe).
7. TOOH with tubing & tie onto 4-1/2" casing. Pump approx. 100 sacks Class C Neat cement to fill the 4-1/2" casing and 8-5/8" X 4-1/2" casing annulus from 370' to surface with cement. Pump additional cement if necessary to circulate cement.
8. Cut off wellhead and install regulation abandonment marker.

NOTE: NOTIFY OCD (748-1283) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS. Procedure was reviewed with Darrell Moore with the OCD on February 15, 1991.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Rusty Klein

TITLE Production Clerk

DATE 8-11-94

TYPE OR PRINT NAME

Rusty Klein

505-748-1471
TELEPHONE NO.

(This space for State Use)

SUPERVISOR, DISTRICT II

APPROVED BY

TITLE

DATE

SEP 6 1994