

WILLIAMS STATE COM # 1 CONT.  
PLUG AND ABANDONMENT

EQUIPMENT. SPOT 35 SXS (125' OH) CLASS C PLUG. PUH TO +/-6400'. CLEAR TUBING. WOC 4 HOURS. RIH AND TAG CEMENT PLUG. REPEAT PROCEDURE IF NECESSARY. CIRCULATE HOLE W/10 PPG GELLED BRINE MUD.

9. PICK UP TUBING TO 5330' (OR 2000' FROM CASING STUB) SPOT 30 SXS (117') CLASS C PLUG @ 5330'. PICK UP TUBING TO 3213'

10. SPOT 30 SXS (117') CLASS C PLUG @ 3213'. PICK UP TUBING TO 2055'.

11. SPOT 30 SXS (115') CLASS C PLUG @ ~~2055~~' (INTERMEDIATE CASING PLUG). PICK UP TUBING TO 302'.

12. SPOT 30 SXS (111') CLASS C PLUG @ 302'. (SURFACE CASING PLUG) POOH W/TUBING. ND BOP.

13. RIH W/TUBING TO 100'. MIX AND PMP 25 SXS CLASS C CMT. CIRCULATE MET TO SURFACE. POOH.

14. CUT OFF CASING 3' BELOW SURFACE. INSTALL P & A MARKER

\* Plug - 7755 - 7055 25 SXS

Plug 1953 - 2070 Tag

Plug 1575 - 1678

Plug 1224-3000