

- 32-36 & 48-54 w/4 JSPF. RD WL co.
18. RIH w/tbg, SN & pkrw/profile nipple & on-off tool, set pkr @ 10,250'.
 19. RU acid co, acidize perfs w/2500 gals 15% HCL w/additives + 80 ball sealers. RD acid co.
 20. RU swab, swab and test well, if marginal or unproductive, release pkr & POOH w/tbg & pkr. ND BOP's, release rig. If productive, follow steps outline in stp #8 for productive well.