Submit 7 Copies to Appropriate District Office

OTHER:

CONDITIONS OF APPROVAL, IF ANY:

State of New Mexico Energy, Minerals and Natural Resources Department

Form C	-103
Revised	1-1-89

DISTRICT			
PO Box 1080	Hobbe	NM	88240

P.O. Box 2088

OIL CONSERVATION DIVISION

30-015-23820

DISTRICT II P.O. Drawer DD, Artesia, NM	88210
חופדשורד ווו	

Santa Fe, New Mexico 87504-2088

5. Indicate Type of Lease STATE FEE

NIN TAIL THE					
1000 Rio Brazos Rd., Aztec, N	√M 87410		4	6. State Oil & Gas Lease No. 88096	
SUNE	DRY NOTICES AND	REPORTS ON W	ELLS 1998 FEB		
(DO NOT USE THIS FOR	M FOR PROPOSALS TO	DRILL OR TO DEEP	EN OR PLUG BACKTOYA	7. Lease Name or Unit Agreement Name	
DIFFERI	ENT RESERVOIR. USE (FORM C-101) FOR S	AFFLICATION FOR I	OCD - ARTESIA	4	
1. Type of Well:	(1 01111 0-101) 1 0110	OUT THO OSALS.)	TOD MITTEOM	and -	
OIL WELL	MEIT X		N. C.	Conoco 9A STATE	
2 Name of Operator		OTHER		<u>/</u>	
The interest of the interest o	reshold Devel	aguant Ca		8. Well No.	
3. Address of Operator	LESUOID NEVEL	opment co			
3. Addies a Operator	CL CL TO	المايا رحم	-	9. Pool name or Wildcat	
4. Well Location	St., Ste II-D	, Ft. Worth	1X +610Z	Turkey Tract Strawn GAS	
	1006		.0.0	1	
Unit Letter	: 1985 Feet Fro	m The NORTH	Line and 1980	Feet From The <u>EAST</u> Line	
	3	19 6	00 -		
Section	Townshi	p 19 5		NMPM EDDY County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)					
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data					
NOTICE	OF INTENTION			SEQUENT REPORT OF:	
			,	DEGOLINI TIEL ONT OLI	
PERFORM REMEDIAL WOR	K L PLUG	AND ABANDON 🔀	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANG	GE PLANS	COMMENCE DRILLING	OPNS. PLUG AND ABANDONMENT	
PULL OR ALTER CASING			CASING TEST AND CE	MENT 10B	

- 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
 - MIRU Pulling unit. NU BOP's. Kill well w/10# brine. 1.
 - Release PLS pkr, POOH w/tbg, pkr, On-Off tool, LD pkr & 2. On-Off tool.

OTHER:

CASING TEST AND CEMENT JOB

- 3. RU WL co & set CIBP #1 @ 10,250', dump 5 sx cmt on top (38' in 5-1/2").
- RIH w/tbg to 10,200' pump 125 bbls of 9.5# mud into hole, 4. est top of mud @ 5000', PUH to 9755'(top of Cisco), RU cmt'g company, pump 25 sx cmt Plug #2, PUH to 8981 (top of Wolfcamp), pump 25 sx Plug #3, PUH to 6851'(top of Bone Springs, Abbo not present), pump 25 sx Plug #4. POOH w/tbg, leave approx 3100' tbg in derrick, LD rest. RD

care g company.		l
Thereby certify that the information above is the and complete to the best of	O(0 to LiTory (Point SEE NEXT PAG	GE)
SIGNATURE	TITLE Petroleum Engineer	C DATE 2/17/98
TYPE OR PRINT NAME Alan T. Davis		TELEPHONE NO. 817870 1482
(This space for State Use)		
species of Mand Stollhold.	Field Recott	3 10 4%

CONOCO 9A STATE#1

5.

RU WL co and cut 5-1/2" csg @ 6500'. Pull and LD csg. RIH w/tbg to 3050' and set 100' plug (50 sx) from 3050 to 2950. PUH to 2500' Wait 4 hrs and tag plug, note depth. PUH to 385', set 100' (35 sx) plug from 385'to 285'. PUH and set 10 sx plug @ sfc. Cut off csg, weld on cap. 6.

RD pulling unit, release rig. 7.