

YATES PETROLEUM CORPORATION  
Sara AHA Com #1  
Section 11-T20S-R24E  
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

9-25-2002 - Pumped down tubing - still did not pressure up - on vacuum. Respotted 50 sacks Class C Neat cement. WOC 4 hours. Did not pressure up. Respotted 50 sacks Class C Neat cement. WOC. Shut well in for night.

9-26-2002 - Pumped down tubing - still did not pressure up. Respotted 50 sacks Class C Neat cement. WOC 4 hours. Did not pressure up. Respotted 50 sacks Class C Neat cement. WOC. Shut well in for night.

9-27-2002 - Pumped down tubing - still did not pressure up. Well still on vacuum. Spotted 50 sacks Class C Neat cement. WOC 4 hours. Did not pressure up. Respotted 50 sacks Class C Neat cement. WOC. Shut well in for night.

9-28-30-2002 - Worked on trying to release tubing anchor. Did not release. Pumped 50 sacks Class C Neat cement. WOC 4 hours. Did not pressure up. Pumped 50 sacks Class C Neat cement with 4% CaCl<sub>2</sub>. WOC. Shut well in for night.

10-1-2002 - Did not pressure up. Spotted 50 sacks Class C Neat cement with 4% CaCl<sub>2</sub>. WOC 4 hours. Did not pressure up. Respotted 50 sacks Class C Neat cement with 4% CaCl<sub>2</sub>. WOC. Shut well in for night.

10-2-2002 - Pumped down tubing - pressured up to 1000 psi for 30 minutes. Bled off. Rigged up wireline. RIH and tagged cement at 7647'. POOH. RIH and perforated 2-7/8" tubing at 7597'. POOH and rigged down wireline. Pressured up to 1000 psi for 30 minutes. Bled off. Shut well in for night.

10-3-2002 - Freepointed tubing. Rigged up wireline. RIH with cutter and cut tubing at 6500'. POOH and rigged down wireline. Pulled up and spotted 25 sacks Class C Neat cement from 6500-6259'. POOH. WOC 4 hours. RIH with tubing - did not tag. Respotted 25 sacks Class C Neat cement from 6500-6259'. POOH. WOC. Shut well in for night.

10-4-2002 - RIH with tubing - did not tag. Spotted 25 sacks Class C Neat cement from 6500-6259'. POOH. WOC 4 hours. RIH with tubing - did not tag. Pumped LCM followed by 25 sacks Class C Neat cement from 6500-6259'. POOH. WOC. Shut well in for night.

10-5-7-2002 - RIH with tubing and tagged cement at 6213'. Pulled up hole. Circulated hole with plugging mud. POOH with tubing. Rigged up wireline. RIH and perforated 5-1/2" casing at 5550'. POOH and rigged down wireline. RIH with packer and tubing. Set packer at 5125'. Squeezed with 25 sacks Class C Neat cement from 5550-5450'. WOC 4 hours. Rigged up wireline. RIH and tagged cement at 5437'. POOH and rigged down wireline. Pulled up and set packer at 4812'. Rigged up wireline. RIH and perforated 5-1/2" casing at 5200'. POOH and rigged down wireline. Squeezed with 25 sacks Class C Neat cement from 5200-5100'. WOC. Shut well in for night.

10-8-2002 - Rigged up wireline. RIH and tagged cement at 5078'. POOH and rigged down wireline. Released packer. Pulled up and set packer at 4468'. Rigged up wireline. RIH and perforated 5-1/2" casing at 4890'. POOH and rigged down wireline. Squeezed with 25 sacks Class C Neat cement from 4890-4790'. WOC 4 hours. Rigged up wireline. RIH and tagged cement at 4753'. POOH and rigged down wireline. Released packer. Pulled up and set packer at 2906'. Rigged up wireline. RIH and perforated casing at 3300'. POOH and rigged down wireline. Pressured up to 1500 psi. POOH with packer. RIH open ended and spotted 25 sacks Class C Neat cement from 3353-3112'. POOH. WOC. Shut well in for night.

10-9-2002 - RIH with tubing and tagged cement at 3089'. POOH with tubing. Rigged up wireline. RIH and perforated 5-1/2" casing at 2126'. POOH and rigged down wireline. RIH with packer and set packer at 1718'. Pressured up to 1500 psi. POOH with packer. RIH open ended to 2181'. Spotted 25 sacks Class C Neat cement from 2181-1939'. POOH. WOC 4 hours. RIH with tubing and tagged cement at 1918'. POOH. Rigged up wireline. RIH and perforated