

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

RECEIVED

SEP 08 1992

WELL API NO.
30-015-24141

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS O. C. D.
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER Dry Hole

2. Name of Operator
Nearburg Producing Company

3. Address of Operator
P. O. Box 823085, Dallas, Texas 75382-3085

4. Well Location
Unit Letter D : 660 Feet From The North Line and 660 Feet From The West Line

Section 14 Township 20S Range 25E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3,415.9' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7/27/92 Mix and pump 25 sx Class H cement plug from 9,500' - 9,122'.
7/28/92 Tag cement plug at 9,103'. Mix, pump, and lay 25 sx cement plug from 8,800' - 8,422'.
7/29/92 Pump 12 sx cement plug from 7,610' - 7,460'. Set retainer at 6,805'. Pump 30 sx Class H cement plug, left 70' cement on top of retainer.
7/30/92 Set 200 sx cement plug from 2,840' - 2,100' per Mike Williams (NMOCD District II Office).
7/31/92 Tag cement plug at 2,450'. Spot 30 sx cement plug from 1,425' - 1,325'. WOC 2 hours and tag at 1,350'. Set an additional 10 sx cement plug at 1,350'. Set 30 sx cement plug from 950' - 850'. Set 30 sx cement plug from 402' - 302'. Set 10 sx cement surface plug. Set dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mildred Simpkins TITLE Production Analyst DATE 9/4/92

TYPE OR PRINT NAME Mildred Simpkins TELEPHONE NO. 214/739-1778

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: