

C-103 (Continued)

Anderson #1

6. Shoot off 2 7/8" tbg at 5800' and pull. Shoot off 4½" casing at 5685' and pull.
7. GIH with 2 7/8" tbg and spot 35 sks of Class H cement with 2% CaCl from 5735' up to 5585'. WOC. Tag plug. This plug covers 4½" casing stub and Wolfcamp formation top.
8. Spot 30 sx Class H with 2% CaCl from 3920' up to 3820'. WOC. Tag plug. This plug covers base of salt.
9. Spot 30 sks Class H with 2% CaCl from 1370' up to 1270'. WOC. Tag plug. This plug covers 8 5/8" casing shoe.
10. Spot 30 sks Class H with 2% CaCl from 510' up to 410'. This plug covers 13 3/8" casing shoe.
11. Spot 50' surface plug.
12. Cut off all casing and anchors. Set P&A marker. Clean and rip location.