

YATES PETROLEUM CORPORATION
Eastern Shore TL Federal #1
Section 8-T19S-R27E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

 
of mandrel top. TIH with 3-3/4" OD short latch overshot, bumper sub, jars, drill collars, accelerator sub and N-80 tubing. Tagged fish - could not get bite. TOOH. TIH with taper tap, bumper sub, jars, drill collars, accelerator sub and tubing. Tag fish - could not feel tap bite. Jarred loose from fish. TOOH. Shut in.

1-6-97 - TIH with 2" spear, bumper sub, jars, drill collars and tubing. Latched onto fish. Jarred 3 hours - did not come loose. Released spear. TOOH. TIH with 3-3/4" shoe, jars, drill collars and tubing.

1-7-97 - Tagged packer with shoe. Rotated on packer - could not get shoe to cut. NOTE: Top of packer spinning on mandrel. Worked 3 hours - no torque. TOOH with tools. Shut down due to weather.

1-8-97 - Shut down due to weather.

1-9-97 - TIH with short catch overshot on tubing. Did not latch onto fish. Rigged up Rotary Wireline. TIH with 1-3/4" chemical cutter. Cut mandrel of packer 2-1/2' down from top of packer. TOOH with wireline. TIH with tapered tap, bumper sub, jars, drill collars and tubing. Tagged fish. Bumped down to engage tap. Pulled up and set jars off - came loose. Set down. Bumped down, pulled up and rotate - jars went off - came loose. Pulled 22 stands. Well started kicking out tubing. Could not pump down tubing. Pumped 100 bbls 2% KCL down annulus. Circulated 60 bbls to tank. Shut well in.



Rusty Klein
Operations Technician
Jan. 10, 1997