Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993

5. Lease Designation and Serial No.

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Submit in Triplicate			
SUBMIT IN TRIPLICATE O. C. D. S. Well Gas Well Other O. C. D. S. Well Other Othe			
Type of Well Gas Geronimo Federal #3 Siete Oil and Gas Corporation Siete Oil and Gas Oil Septoratory Area Shugart Delaware E. Siete Oil and Gas Oil Septoratory Area Shugart Delaware E. Shu			
1. Type of Well Gas			
2. Name of Operator Siete Oil and Gas Corporation 3. Address and Telephone No. P.O. Box 2523, Roswell, NM 88202-2523 4. Location of Well (Flootage, Sec. T. R. M., or Survey Description) Sec. 24, T18S, R31E 890' FNL & 990' FEL NE½NE¾, Unit Letter A CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Abandonment Recompletion Plugging Back Casing Repair Altering Casing Other Altering Casing Water Shu-Off Conversion to Injection Dispose Water (Non: Report results of multiplecompletion on Well Completion or Recompleted Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970' & set, SI for buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/per guns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, stan swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
Siete Oil and Gas Corporation 3. Address and Telephone No. P. O. BOX 2523, Roswell, NM 88202-2523 4. Location of Well (Footage, Sec., T., R. M., or Survey Description) Sec. 24, T18S, R31E 890' FNL & 990' FEL NE\(\frac{1}{2}\) NIL Letter A CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Subsequent Report Pinal Abandonment Notice Recompletion Pinal Abandonment Notice Recompletion Pinal Abandonment Notice Abandonment Abandonment Other Abandonment Other Abandonment Other Abandonment Other Abandonment Notice Abandonment Other Abandonment Oth			
3. Address and Telephone No. P.O. Box 2523, Roswell, NM 88202-2523 4. Location of Well (Footage, Sec., T. R., M., or Survey Description) Sec. 24, T18S, R31E 890' FEL NE¾NE¾, Unit Letter A 12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent			
P.O. Box 2523, Roswell, NM 88202-2523 4 Location of Well (Footage, Sec., T. R. M., or Survey Description) Sec. 24, T18S, R31E 890' FNL & 990' FEL NE\$\text{NE}\text{NE}\text{, Unit Letter A} CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Notice of Intent Recompletion Plugging Back Plugging Back Non-Routine Fracturing Other Oth			
4. Location of Well (Footage, Sec. T. R. M. or Survey Description) Sec. 24, T18S, R31E 890' FNL & 990' FEL NE\(\frac{1}{2}\) Unit Letter A TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Subsequent Report Pinal Abandonment Notice Abandonment Subsequent Report Subsequent Report Subsided Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* Shugart Delaware E. 11. County or Parish, State Eddy NM TYPE OF ACTION TYPE OF ACTION Abandonment Now Construction Non-Routine Fracturing Non-Routine Fracturing Non-Routine Fracturing Non-Routine Fracturing Oneserible Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970' & set, SI for buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/perguns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, Ho, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbg & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
Sec. 24, T18S, R31E 890' FNL & 990' FEL NE\(\) NE\(\) NE\(\) Unit Letter A CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Subsequent Report Plugging Back Casing Repair Casing Repair Conversion to Injection Dispose Water (Note: Report results of multiple completion or Well Completion or Recompletion or Recompl			
890' FNL & 990' FEL NE\{\}\) Unit Letter A CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Ontice of Intent Ontice of Intent Other Casing Repair Other Conversion to Injection Injection of Materiag Casing Repair Other Conversion to Injection of Materiag Casing Repair Other Conversion of multiple completion on well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970' & set, SI for buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/per guns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
NEINE Notice of Intent Notice of Intent Abandonment Change of Plans			
TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent			
TYPE OF SUBMISSION Notice of Intent			
Notice of Intent			
Recompletion Plugging Back Plugging Back Plugging Back Plugging Back Plugging Back Plugging Back Pother Other Othe			
Subsequent Report Plugging Back Water Shut-Off Water Shut-Off Water Shut-Off Water Shut-Off Casing Repair Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 3. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970			
Casing Repair Altering Casing Other			
Altering Casing Other Ot			
Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion or Recompletion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970			
(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970' & set, SI for buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/perguns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbg & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970' & set, SI for buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/per guns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 9/14/91 TOH w/rods & tbg, TIH w/pressure bombs & pkr to 4970' & set, SI for buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/perguns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/perguns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
buildup. 9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/perguns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
9/16/91 Start flwg well dn, unseat pkr, TOH w/pressure bombs, TIH w/per guns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns @ pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
guns, reset pkr @ 5073', pressure test pkr to 750 psi, held ok, star swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pkr SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
swabbing to SN, well built up w/paraffin, HO, TOH w/perf guns & pki SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
SION. 9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
9/17/91 TIH w/tbq & SN, swab to SN, TOH, TIH w/pressure bombs, perf guns			
nkr set nkr 0 5085 81! pressure test nkr to 600 psi for 5 min. pl			
holding, SION.			
9/18/91 Swab fluid dn to SN, perfed 5170'-5189', SION.			
9/19/91 TIH w/swab, pull sample, TOH w/bombs, guns & pkr.			
9/20/91 TIH w/bombs, guns & pkr, set pkr @ 5196.4', test pkr to 750 psi fo			
5 min, holding ok, swab to SN, perfed 5221'-5258', SI for pressur			
buildup.			
14. I hereby certify that the foregoing is true and correct Drilling Technician 10/30/91			
Signed Ce Battley - Selly Title Date Date			
(This space for Federal or State office use) Approved by Title Date			

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.