

Operator

Momentum Oper Co.

Well

Hinkle F #11

Unit

C Section 27 Township 18 Range 31

API #

30-015-25554

TOPS

Rustler	620
Salade	875
B Salt	1960
Gates	2130
Trivers	2550
Queen	3270
Pennose	3540
Grayburg	3620

← Surface Plug

← Shot Plug 683'-783' Tag

← Plug 2060' Tag

3562' ← Plug 3512' Tag
4148'

8 1/8" @ 733'
CIRC

5 1/2" @ 4240
CIRC

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.