

CISF

RECEIVED

OCT 31 9 39 AM '94

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

RAY WESTALL

3. Address and Telephone No.

P.O. BOX 4 LOCO HILLS, NM 88255 (505) 677-2370

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2310' FSL & 2180' FEL
SECTION 12 T18S R31EFORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM 047800-A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8910088600

8. Well Name and Unit
TAYLOR FEDERAL 17

9. API Well No.

30-015-26660

10. Field and Pool, or Exploratory Area

SHUGART/YATES/7RVRS/

11. County or Parish, State GRBURG

EDDY

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent☒ Subsequent Report☐ Final Abandonment Notice

TYPE OF ACTION

☐ Abandonment☒ Recompletion☐ Plugging Back☐ Casing Repair☐ Altering Casing☐ Other☐ Change of Plans☐ New Construction☐ Non-Routine Fracturing☐ Water Shut-Off☐ Conversion to Injection☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9/28/94 RIG UP ON WELL. PUMP 50 BBL HOT WATER DOWN BACKSIDE. LOG WELL 3700' TO 3300'. PERF WITH 3 1/8" CSG GUN (3586-96) 21 HOLES. GO IN HOLE W/TUBING TO 3900' & SHUT DOWN FOR NIGHT.

9/29/94 CIRCULATE 2% KCL DOWN BACKSIDE & OUT TUBING TIL CLEAN. SET CIBP @ 4230 W/35 SX "C" (124 JTS IN HOLE) TEST PLUG & SPOT ACID. SET PKR 111 JTS IN @ 3499. ACIDIZE W/1000 GAL 15% NEFE., BREAKDOWN 2300#/TREATING PSI 1000#, BALL OUT & SURGED BALLS OFF, FINISH TREATING @ 3 BPM 1000# ISDP 900# SWAB BACK TIL 4:00 PM NO OIL OR GAS SHOW. RELEASE PKR & COME OUT OF HOLE W/TUBING. LAY DOWN PKR & CAP OFF WELL HEAD. SHUT DOWN.

9/30/94 FRAC W/40,000 GAL LINEAR GEL & 66,000# SAND. SHUT IN OVERNIGHT 10/1/94 WELL ON VACUUM GO IN HOLE W/TUBING & TAG FILL 100' BELOW PERFS LAND TUBING 111 JTS IN HOLE @ 3500' RUN 2 1/2" PUMP & 138 RODS HANG WELL ON

NOV 14 1994

CARLSBAD, NEW MEXICO

14. I hereby certify that the foregoing is true and correct

Signed

Title

PRODUCITON ANALYST

Date

10/27/94

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any: