Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form	C	-10	3
Revis	ed	1-1	-89

- DATE

103 L-1-89	- (21/5 K
		. UI

DISTRIC	LI			
P.O. Box	1980,	Hobbs,	NM	88240

OIL CONSERVATION DIVISION P.O. Box 2088

WELL API NO. 30-015-26824

DISTRICT II P.O. Drawer DD, Artesia, NM 882	Santa Fe, New Mexico	8/JKEENVED	5. Indicate Type of Lease
DISTRICT III		MAR - 9 1992	STATE FEE X
1000 Rio Brazos Rd., Aztec, NM	87410	mmn 3 133L	6. State Oil & Gas Lease No.
OL NIDDY	NOTICES AND DEPORTS ON WE	O. C. D.	
(DO NOT USE THIS FORM FO	NOTICES AND REPORTS ON WE OR PROPOSALS TO DRILL OR TO DEEPE	N OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
DIFFERENT	RESERVOIR. USE "APPLICATION FOR PI	ERMIT	
1. Type of Well:	ORM C-101) FOR SUCH PROPOSALS.)		Thomas AJJ
OT. — GA	S OTHER		Thomas 1100
2. Name of Operator	/		8. Well No.
YATES PETROLEUM CO	ORPORATION /		3
3. Address of Operator			9. Pool name or Wildcat North Dagger Draw U/Penn
l	, Artesia, NM 88210		North Dagger Draw Offenn
4. Well Location	1980 Feet From The South	1980	Feet From The East Line
Unit Letter:	Feet From The Bodell	Line and	rea rion the
Section 8	Township 19S	Range 25E	NMPM Eddy County
	10. Elevation (Show whether	er DF, RKB, RT, GR, etc.)	<i>\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\</i>
<u> </u>	3546' GR	N	VIIIIIIIII
	heck Appropriate Box to Indicate		
NOTICE C	F INTENTION TO:	SUE	BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	G OPNS. PLUG AND ABANDONMENT
PULL OR ALTER CASING	PULL OR ALTER CASING CASING TEST AND CEMENT JOB		
OTHER:		OTHER: Product:	ion Casing, Perforate, Treat X
12 Describe Proposed or Complete	ted Operations (Clearly state all pertinent details,	and give pertinent dates, incli	uding estimated date of starting any proposed
TD 8230'. Reached	TD 10:00 PM 3-2-92. Ran	198 joints /" 2.	3# and 26# N-80 and J-55 casing
set at 8230'. Floa	at shoe set at 8230', IIOa	t collar set old	6'. DV tool set 5616'. Cmt'd 5# Gilsonite + 5# Silicalite +
in 2 stages. Stage	Halad 14 (vield 1.34, wt	1.34). PD 11:00	AM 3-3-92. Circulated thru DV
too1 2 hrs and 15 i	minutes. Circulated 170 s	acks. Stage 2:	800 sx Howco Lite "H" + 5#
Cilconite + 1/4# F	10cele + 5# salt (vield 1.	92. wt 12.7). T	ailed in w/100 sx "H" Neat (yield
1 18 wt 15.6). Pi	n 2:18 PM 3-2-92. Circula	ted 150 sacks.	Bumped plug to 3100 psi for i
minute, float and	casing held OK. WOC 24 hr	s. Drilled out	DV tool at 3616. Periorated
7748-7846 1 11/44 -	.51" holes as follows: 77	48, 50, 52, 54,	56, 58, 60, 66, 68 and 7770'
(2 SPE_20 holes)	7796, 98, 7800, 02, 04, 1	0. 12 and 7714'	(2 SPF-16 holes), /840, 42, 44
and 78/6! (2 SDE-8	holes). Straddled perfs	7840-46'. Commu	inicated up. Moved packer above
nowfo 7706! Comm	unicated up. Moved packer	above perfs //4	8'. Treated W//400 gals 20% NEFE
acid. Straddled	perfs 7748-78 14'. Treated	w/20000 gals 20	NEFE acid. Swabbing and flowing
recovering load.			
I hereby certify that the information a	above is true and complete to the best of my knowledge		2.7.02
SIGNATURE anta	Doodlik	mme Production S	Supervisor 3-7-92
TYPE OR PRINT NAME J	uanita Goodlett		TELEPHONE NO. 505/748-1471
(This space for State Use)	DICINIA! CICNIED DV		
	RIGINAL SIGNED BY IKE WILLIAMS		MAR 1 3 1992

SUPERVISOR, DISTRICT IT

APPROVED BY --

CONDITIONS OF APPROVAL, IF ANY: