Submit 3 Copies to Appropriate District Office

## State of New Mexico Ene of, Minerals and Natural Resources Department

Form	C	-10	U
Revis	eđ	1-1	-89

P.O. Box 1980, Hobbs, NM 88240

**OIL CONSERVATION DIVISION** P.O. Box 2088

P.O. Drawer DD, Artesia, NM 88210

Santa Fe. New Mexico 87504-2088

5.	Indicate Type of Lease	च्च	1	r

WELL API NO.

DISTRICT III 1000 Rio Brazos R	ld., Azlec, NM	87410
-----------------------------------	----------------	-------

STATE FEE L 6. State Oil & Gas Lease No.

**ALTERING CASING** 

SUNDRY NOTICES AND REPORTS ON WELLS  ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  (FORM C-101) FOR SUCH PROPOSALS.)		7. Leas	7. Lease Name or Unit Agreement Name				
Î.	Type of Well: OIL GAS WELL X WELL	OTHER		Cor	ntinental	State	
2.	Name of Operator Anadarko Petroleum (	Corporation /MAR )	5 1994	8. Wel 12			
3.	Address of Operator PO Drawer 130, Artes		• • •		name or Wildcat ckey Track	7R, Qn,	GB, SA
4.	Well Location Unit Letter N: 330	Feet From The South	Line and	1980	Feet From The	West	Line
	Section 10	Township 19S Range	29E	NMPM	Eddy	,,,,,,,,,,,,,	County
		10. Elevation (Show whether DF)					
11	. Check Ap	propriate Box to Indicate Na	ture of Notice,	, Report,	or Other Date	a	

REMEDIAL WORK PERFORM REMEDIAL WORK PLUG AND ABANDON PLUG AND ABANDONMENT COMMENCE DRILLING OPNS. **CHANGE PLANS TEMPORARILY ABANDON** CASING TEST AND CEMENT JOB **PULL OR ALTER CASING** OTHER: OTHER:

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MI RUPU. TOH w/production string.

**NOTICE OF INTENTION TO:** 

2. TIH w/RBP and pkr. Set RBP @ 1687' and tested 1000# OK. Dumped 2 sx sand on top of RBP. TOH w/pkr.

3. RU Wedge Wireline Co. Ran 4" gun and perforated 38-.5"dia holes at 1560'-1575', 1591'-1605', 1611'-1614', 1618'-1620' in 7 Rivers Zone. Wedge Wireline Co.

4. RU BJ Services and acidized 7 Rivers perfs w/1500 gals of 75% NE-FE acid w/75 ball sealers. Did not ball out. Max press 1780# PSI. AIR&P 3.9 BPM at 1200#. Pkr was set @ 1483'. RU swab and swabbed tbg dry. TOH w/pkr.

5. RU BJ Services and fraced down 5½" csg w/27,000 gals of Cross Linked Gel & 99,760# 12/20 Brady sand in 5 stages. (Spartan Frac 3000). Max press 2030# PSI. Max Rate 36.1 BPM. AIR&P 35.8 @ 1500# PSI. ISIP 1730# press. (Cont'd) RD BJ Services.

I hereby certify that the information above in true and complete to the best of my knowledge and SKINATURE SKINATURE T	mue <u>Field Foreman</u>	DATE 03-14-94
TYPE OR PRINT NAME		TELETIONE NO.
(This space for State Use)		MAD 9 1 100A

mme -

SUPERVISOR, DISTRICT II

CONDITIONS OF AFTROVAL, IF ANY:

SUBSEQUENT REPORT OF: