to Appropriate District Office	Energy, .erals and Natural Res		Form C-103 Revised 1-1-89
DISTRICT	OIL CONSERVATION	N DIVISION	WELL API NO.
P.O. Box 1980, Hobbs, NM 88240 DISTRICT II P.O. Box 2088 Santa Fe, New Mexico 87504-2088		<u>30-015-28418</u>	
P.O. Drawer DD, Artesia, NM 88210			5. Indicate Type of Lease STATE X FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Lesse No. LG-6459
(DO NOT USE THIS FORM FOR PI DIFFERENT RES (FORM	TICES AND REPORTS ON WELL ROPOSALS TO DRILL OR TO DEEPEN C ERVOIR. USE "APPLICATION FOR PERI C-101) FOR SUCH PROPOSALS.)	OH PLUG BACK TO A	7. Lease Name or Unit Agreement Name
1. Type of Well: OL. GAS WELL X WELL	OTHER		Agave AAJ State
2. Name of Operator			8. Well No.
YATES PETROLEUM CORPO	JRATION		9. Pool name or Wildcat
3. Address of Operator 105 South 4th St., Ar	rtesia. NM 88210		Siegrest Draw Abo
4 Well Location	980 Feet From The North	Line and 66	0 Feet From The West Line
	Township 195 Ran 10. Elevation (Show whether L 3814' k Appropriate Box to Indicate N NTENTION TO: PLUG AND ABANDON	GR Vature of Notice, F	NMPM Eddy County Report, or Other Data County County BSEQUENT REPORT OF: County County County County County
		COMMENCE DRILLIN	
		CASING TEST AND C	
		OTHER: Perforat	ze, acidize & frac X
12. Describe Proposed or Completed Op	verations (Clearly state all pertinent details, an	d give pertinent dates, incl	luding estimated date of starting any proposed
<pre>work) SEE RULE 1103. 5-23-95 - Cleaned 1 Nippled up tubing h 5-24-95 - Moved in and 2-7/8" tubing t psi, OK. TOOH with Ran CBL/CCL/GR log. 5-25-95 - Shut down 5-26-95 - Rigged up .52" holes as follor rigged down wirelin annulus to 1000 ps: and ball sealers.</pre>	Location, set and tested nead. Shut down. and rigged up pulling un to 4190'. Circulated cas n tubing, scraper and bit . TOOH with logging tool n. o wireline. TIH with 4" ows: 4064-4068', 4078-40 ne. TIH with packer and i, OK. Acidized perforat Unset packer at 4014'.	anchors and ma nit. Nippled us sing with 2% K(t. Rigged up w l and rigged do casing guns a 080' and 4087- 2-7/8" tubing tions 4064-409 T00H with tub st in 7 stages	arkers. Made cut off on 7" casin up BOP. TLH with bit, Straper CL water. Tested casing to 3000 wireline. TIH with logging tools own wireline. Shur down. nd perforated 4064-4090' w/39 4090' TOOH with casing guns and . Set packer at 4014'. Tested 0' with 6000 gailons 20% NEFE aci ing and packer. Nippled down BOP . Nippled down frac valve and
work) SEE RULE 1103. 5-23-95 - Cleaned 1 Nippled up tubing h 5-24-95 - Moved in and 2-7/8" tubing t psi, OK. TOOH with Ran CBL/CCL/GR log. 5-25-95 - Shut down 5-26-95 - Rigged up .52" holes as follor rigged down wireling annulus to 1000 ps: and ball sealers. Installed frac valu- installed frac valu-	ocation, set and tested nead. Shut down. and rigged up pulling ur to 4190'. Circulated cas n tubing, scraper and bit . TOOH with logging tool n. o wireline. TIH with 4" ows: 4064-4068', 4078-40 ne. TIH with packer and i, OK. Acidized perforat Unset packer at 4014'. ve. Pumped step rate test H with packer and tubing	anchors and ma nit. Nippled us sing with 2% KG t. Rigged up w l and rigged do casing guns a 080' and 4087 2-7/8" tubing tions 4064-409 TOOH with tub st in 7 stages . Set packer	arkers. Made cut off on 7" casin up BOP. Till with bit, Straper CL water. Tested casing to 3000 wireline. Till with logging tools own wireline. Shur down. and perforated 4064-4090' w/39 4090'() TOOH with casing guns and . Set packer at 4014'. Tested 0' with 6000 gallons 20% NEFE aci ing and packer. Nippled down BOP . Nippled down frac valve and at 4014'. Swabbing.
<pre>work) SEE RULE 1103. 5-23-95 - Cleaned 1 Nippled up tubing h 5-24-95 - Moved in and 2-7/8" tubing t psi, OK. TOOH with Ran CBL/CCL/GR log. 5-25-95 - Shut down 5-26-95 - Rigged up .52" holes as follor rigged down wirelin annulus to 1000 ps: and ball sealers. Installed frac valu installed BOP. TIL Ihereby cerufy that the information above</pre>	ocation, set and tested nead. Shut down. and rigged up pulling ur to 4190'. Circulated cas n tubing, scraper and bit . TOOH with logging tool n. o wireline. TIH with 4" ows: 4064-4068', 4078-40 ne. TIH with packer and i, OK. Acidized perforat Unset packer at 4014'. ve. Pumped step rate test H with packer and tubing	anchors and ma nit. Nippled us sing with 2% KG t. Rigged up w l and rigged do casing guns at 080' and 4087- 2-7/8" tubing tions 4064-409 TOOH with tub st in 7 stages . Set packer	arkers. Made cut off on 7" casin up BOP. Till with bit, Straper CL water. Tested casing to 3000 wireline. Till with logging tools own wireline. Shur down. and perforated 4064-4090' w/39 4090'() TOOH with casing guns and . Set packer at 4014'. Tested 0' with 6000 gailons 20% NEFE aci ing and packer. Nippled down BOF . Nippled down frac valve and at 4014'. Swabbing.
work) SEE RULE 1103. 5-23-95 - Cleaned 1 Nippled up tubing h 5-24-95 - Moved in and 2-7/8" tubing t psi, OK. TOOH with Ran CBL/CCL/GR log. 5-25-95 - Shut down 5-26-95 - Rigged up .52" holes as follor rigged down wireling annulus to 1000 ps: and ball sealers. Installed frac valu- installed frac valu-	accation, set and tested nead. Shut down. and rigged up pulling ur to 4190'. Circulated cas n tubing, scraper and bit TOOH with logging tool n. p wireline. TIH with 4" ows: 4064-4068', 4078-40 ne. TIH with packer and i, OK. Acidized perforat Unset packer at 4014'. ve. Pumped step rate test H with packer and tubing	anchors and ma nit. Nippled us sing with 2% KG t. Rigged up w l and rigged do casing guns a 080' and 4087 2-7/8" tubing tions 4064-409 TOOH with tub st in 7 stages . Set packer	arkers. Made cut off on 7" casin up BOP. Till with bit, Straper CL water. Tested casing to 3000 wireline. Till with logging tools own wireline. Shur down. and perforated 4064-4090' w/39 4090'() TOOH with casing guns and . Set packer at 4014'. Tested 0' with 6000 gailons 20% NEFE aci ing and packer. Nippled down BOF . Nippled down frac valve and at 4014'. Swabbing.