Form 3160-5 (August 1999) UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0135

OMB No. 1004-0135 Expires November 30,2000 clsp

					į			
SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or re enter an an abandoned well. Use Form 3160-3 (APD) for such proposals.  SUBMIT IN TRIPLICATE - Other instructions on reverse side					5. Lease Serial No.			
					NM-120833			
					6. If Indian, Allottee or Tribe Name			
					7 If Unit or CA/Agreement, Name and/or No			
1 Type of Well								
X Oil well Gas Well	Other				8. Well Name and No.			
2 Name of Operator		10 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Rio Penasco MF Fed. Com #2		m #2			
	eum Corporation			9. API Well No. 30-015-29255				
a. Address	aurilla Ctraat	3b. Phone No.(include area code) 505-748-1471			10. Field and Pool, or Exploratory Area			
105 South F		-/40-14/1		Dagger Draw Upper Penn, No.				
4 Location of Well	(Footage, Sec.,T.,R.,M.,			11. County or Parish, State				
1980' FNL & 660' FWL of Section 11-T19S-R25E Ur				W	Eddy Co., NM			
12. CHECK APPR	OPRIATE BOX(ES)	TO INDICATE NAT	TURE OF N	OTICE, RE	PORT, OR OTHE	R DATA		
TYPE OF SUBMIS				ACTION		-		
		Deepen		Start/Resume)	Water Shut-Off			
Notice of Intent  X Subsequent Report	Acidize Alter Casing	Fracture Treat	Reclamation	narvi (courie)	Well Integrity			
					Tother Re-entry	_		
	Casing Repair	New Construction	Recomplete	Nhaadaa				
	Change Plans	Plug and Abandon	Temporarily /	Abandon	production casing &	cement		
Final Abandonment Notice	Convert to Injection	Plug Back	Water Dispo	sal	perforate and acidiz	e		
Attach the Bond under which the following completion of the involved	I/2" arrow. Set 1 pace 750 gal 15% IC/HC in 750 gal 15% IC/HC in perfs 9312-9321' (ker, TOH. 1-5-01-Si). TIH with 4 1/2" Arrow. 1/6/01-acidize in the perfs of th	vide the Bond no. on file with results in a muliple completion all be filed only after all required to the filed only after all requirements and the filed only after the f	n BLM/BIA. Require or recompletion in a irements, including I to 9250'. 1 ant package, gals of 15% 276'. Perf Len on/off tool 9230-9240'= bw perfs. Ni Perf Upper Matter Date	d subsequent reinew interval, a reclamation, have reclamation, have reclamation and reclamatio	eports shall be filed within 3 Form 3160-4 shall be filed we completed, and the operator acidize Chester Set packer at 9254' conionic sufactant above zone with 4 JSF profile to 9130'. Fewith 1000 gels 0-75 in tree and nippled	once tor has Lime Lime Cacid. PF Prep 5% up BOP. 8-9026'		
	THIS SPACE FO	R FEDERAL OR STAT	E OFFICE US			<del> \$</del>		
Approved by			Title		Date		RECEN	
Conditions of approval, if any, are certify that the applicant holds legs Which would entitle the applicant to	al or equitable title to those rights o conduct operations thereon.	in the subject lease	Office		TED FOR RECO		OCD AF	
Title 18 U.S.C. Section 1001 and States any false, fictitious or fraud				nake to any de	partment or agency of the Uni	ed		
oraces any raise, inclinious or flauti	and a second residence of the second			F	<del>1 2 t</del>			
					XIS C. SWOBODA OLEUM ENGINEER			

Rio Penasco MF Federal Com #2 11-19S-25E Eddy County, New Mexico

1/11/01-TIH with 4-1/2" arrow set packer at 8900'. Acidized upper Morrow perf 9018-9038'= 64 holes with 1000 gal of 7.5% MSA with 96 ball sealers. Ball out with 96 ball sealers on at 4000 psi. Surge off ball sealers. 1-31-01- move in and rig up unit. RIH with blanking plug. Plug hung up at 8500'. Set in plug in profile nipple. Prep to test plug and pull 2-3/8" tubing. Released and pulled on/off and 2 3/8" tubing. Picked up 1500' of 2 7/8" L-80 tubing with turned down collars, 3-1/2" x 2-7/8" x -over, 3000' of 3-1/2" of N-80 tubing. Prep to resume TIH with on/off tool and frac string. 2-2-01- resumed TIH with 3-1/2" frac string. Latch onto packer at 8900'. Frac Upper Morrow perfs 9018-9036', 9032-9038' 64 holes with 41,260 lb = 20/40 AcFrac, with 611 bbls CO2, with 13,137 gal gelled fluid. Close in well for 3 hours while rigging down frac crew and rigged up flow crew. 2-6-01-open on 3/8" choke. Set blanking plug in packer at 8900'. 2/7/01-resumed TOH laying down frac string, TIH with on/off tool with 2 3/8" L-80 prod string to liner top. 2/8/01- resumed TIH with on/off tool. Engage packer at 8900'. Moved in and rigged up slickline truck. Pulled blanking plug. RIH with swab and tag at 2200'. 2/9/01- rigged down and moved off. Released all rental equipment.