


Operator Roy Westall
 Well Federal State Station #1
 Unit 2 Section 20 Township 10 Range 20
 API # 30-015-27200

TOPS

Grass	2
Timbers	992
Bearings	1342
Quartz	1510
San Andres	2360'
- Bone Spring	3482'
- Wolfcamp	5800'
Penn	9380'
Concho	9675'
- Strauss	9895'
Del Rio	10211'
Mexican Limestone	10643'
Mexican Shale	10761'

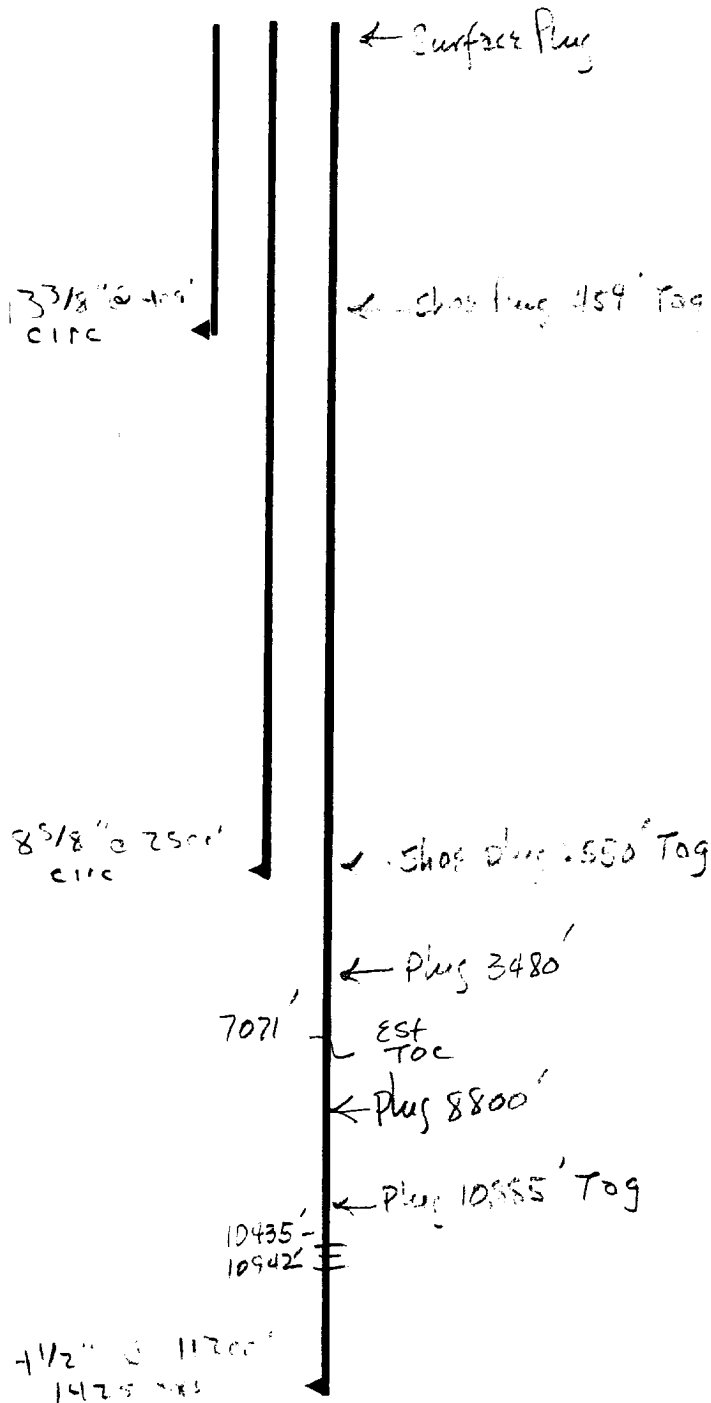

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

1/6