

Operator Ready Oil & Gas Mngt
 Well Willis Federal #3
 Unit G Section 13 Township 2e Range 28
 API # 30-015-02356

TOPS

Salade ~ 450'
Base Salt ~ 650'
Cyres ~ 750'

← 60' Surface Plug.

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

?

No casing Records
 Procedure MAY
 Change.

← 450'. cement Plug Inside & Outside casing. TAG
 Top SALT Plug / Shoe Plug.

← Cement Plug from TD - 650'. shoe Plug / Base SALT Plug. TAG

MS