				ds
			CONS. C (ISSI)	ON FORM APPROVED
rm 3160-5		ED STATES Drawer		Budget Bureau No. 1004-0135
ine 1990)	DEPARTMENT	OF THE INTERIORITES	La, NM 88210	Expires: March 31, 1993 5. Lease Designation and Serial No.
	BUREAU OF LA	ND MANAGEMENT		5. Lease Designation and Schar No.
			,	<u>NM-56350</u>
	SUNDRY NOTICES A	ND REPORTS ON WELL	LS	6. If Indian, Allottee or Tribe Name
Do not use this	form for proposals to drill	or to deepen or reentry to	a different reservor	ir.
	Lise "APPLICATION FOR	PERMIT-" for such propo	osals	
				7. If Unit or CA, Agreement Designation
	SUBMIT	IN TRIPLICATE		
			<u></u>	
. Type of Well	and the second			8. Well Name and No.
Well KX W	Vell Other and the Strategy of			Lowe Staple AMR Federal #
Name of Operator		(505) 74		9. API Well No.
	ROLEUM CORPORATION	(505)		·····
3. Address and Telephone No.				10. Field and Pool, or Exploratory Area
105 South 4th St., Artesia, NM 88210				Wildcat Morrow
. Location of Well (F	Footage, Sec., T., R., M., or Survey De	scription)		11. County or Parish, State
14501 89	L & 2310' FWL of Sec	tion 22-T21S-R24E		
T010 L9				Eddy Co., NM
	· · · · · · · · · · · · · · · · · · ·	politika (1996)		
	CK APPROPRIATE BOX) TO INDICATE NATUR	E OF NOTICE, RE	PORT, OR OTHER DATA
		· 	TYPE OF ACT	ION
TYPE	OF SUBMISSION			Change of Plans
	otice of Intent	Abandonment		
		Recompletion		Non-Routine Fracturing
v v s	ubsequent Report	Plugging Back	K	
<u></u>	ubsequent report	Casing Repair	r	Water Shut-Off SUN DO
Final Abandonment Notice		Altering Casi	ng	Conversion to Injection
Final Abandonment Notice		X Other Com	mence re-entry	(Note: Report results of multiple completion on Well
	· · · · ·	· · ·		Completion or Recompletion Report and Log form.) starting any proposed work. If well is diffectionally drilled,
give subsuria 6-9-93:	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg	noved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug	marker. Welded on 9-5/8" oled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from
give subsurfa 6-9-93:	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 2'. Washed down to down to 9366'. Dri- culated clean.	noved dry hole m anchors. Nipp bit, drill col Notified Shann ug at 4650'. D ged cement plug 8300'. Drille lled cement plu	marker. Welded on 9-5/8" oled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed
give subsurfa 6-9-93:	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg '2'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line.	noved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH	marker. Welded on 9-5/8" oled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from
give subsurfa 6-9-93:	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circ TOOH w/tubing, dril tubing to 3155'. R: TOOH w/tubing, dril	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg '2'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line.	noved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH	narker. Welded on 9-5/8" oled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed
give subsulta 6-9-93:	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circ TOOH w/tubing, drill tubing to 3155'. R TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 22'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line. L collars and bit.	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	<pre>marker. Welded on 9-5/8" pled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed</pre>
give subsulta 6-9-93: 14. I hereby certify	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circo TOOH w/tubing, drill tubing to 3155'. R: TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg '2'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line.	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	narker. Welded on 9-5/8" oled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed
give subsurfa 6-9-93: 14. I hereby certify Signed	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circ TOOH w/tubing, drill tubing to 3155'. R: TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 22'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line. L collars and bit.	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	<pre>marker. Welded on 9-5/8" pled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed</pre>
give subsurfa 6-9-93: 14. I hereby certify Signed (This space for	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circo TOOH w/tubing, drill tubing to 3155'. R: TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 22'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line. L collars and bit.	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	<pre>marker. Welded on 9-5/8" pled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed</pre>
give subsurfa 6-9-93: 14. I hereby certify Signed (This space for Approved by	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circ TOOH w/tubing, drill tubing to 3155'. R: TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 2'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line. L collars and bit. TitleProduct:	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. D ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	narker. Welded on 9-5/8" oled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed Date June 25, 1993
give subsurfa 6-9-93: 14. I hereby certify Signed (This space for Approved by Conditions of a	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circ TOOH w/tubing, drill tubing to 3155'. R: TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 2'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line. L collars and bit. Title	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. Dr ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	narker. Welded on 9-5/8" pled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed Date June 25, 1993 ACCO Date June 25, 1993
give subsurfa 6-9-93: 14. I hereby certify Signed (This space for Approved by Conditions of a	Dug out cellar, clea stub with 11" X 3000 blind rams to 500 ps Tested pipe rams to BLM in Carlsbad abou Washed down to 4650' 4650-4880'. Washed cement from 5972-607 8300-8415'. Washed down to 9902'. Circ TOOH w/tubing, drill tubing to 3155'. R: TOOH w/tubing, drill 7" casing rams.	ned location and rem starting head. Set i, OK. TIH w/8-3/4' 500 psi, OK. NOTE: t spud. . Tagged cement plu down to 5972'. Tagg 2'. Washed down to down to 9366'. Dri culated clean. L collars and bit. igged up on 6 line. L collars and bit. Title	hoved dry hole m anchors. Nipp bit, drill col Notified Shann ag at 4650'. Dr ged cement plug 8300'. Drille lled cement plu Ran logs. TIH TIH to 9902'. Changed 2-7/8"	narker. Welded on 9-5/8" pled up BOP. Tested llars and tubing to 3155'. non Shaw w/BLM with the rilled cement from at 5972'. Drilled d cement plug from g from 9366-9466'. Washed w/bit, drill collars and Circulated 2-1/2 hours. tubing rams. Installed Date June 25, 1993