Submit 3 Copies		
to Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources Depa	$\frac{\text{Form C-103}}{\text{Revised 1-1-89}} = \frac{5}{2} \sqrt{5}$
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATION DIVIS	ION WELL API NO.
•	P.O. Box 2088	30-015-10414
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease STATE X FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410		6. State Oil & Gas Lease No. VA-636
SUNDRY NOT	ICES AND REPORTS ON WELLS	
( DO NOT USE THIS FORM FOR PR DIFFERENT RESE	OPOSALS TO DRILL OR TO DEEPEN OR PLUG BAC RVOR. USE "APPLICATION FOR PERMIT" C-101) FOR SUCH PROPOSALS.)	CK TO A 7. Lease Name or Unit Agreement Name
1. Type of Well:		ε F
WELL CAS WELL X	) OTHER	Archimedes ARM State Com
2. Name of Operator YATES PETROLEUM CORPOR	ratión JUL - 8 199	8. Well No. 1
3. Address of Operator		9. Pool name or Wildcat
105 South 4th St., Art 4. Well Location	tesia, NM 88210	Indian Basin Morrow, East
	0 Feet From The South Line and	i 1980 Feet From The East Line
Section 18	Township 21S Range 24E	NMPM Eddy County
	10. Elevation (Show whether DF, RKB, RT, GI	R, etc.)
	Appropriate Box to Indicate Nature of N	otice Penort or Other Data
NOTICE OF IN		SUBSEQUENT REPORT OF:
PULL OR ALTER CASING		
DTHER:		Re-entry X
work) SEE RULE 1103.	rations (Clearly state all pertinent details, and give pertinent of	dates, including estimated date of starting any proposed
6-27-97 - Scraped off	road and location. Dig out cel	llar and dry hole marker. Installed
11" X 3000# weld-on h	nead on 9-5/8" casing.	llar and dry hole marker. Installed
11" X 3000# weld-on h 6-28-97 - Put caliche	nead on 9-5/8" casing. A on road and location. Start mo	oving in equipment.
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams	nead on 9-5/8" casing. e on road and location. Start mo nd rigged up pulling unit and re- s to 1000#.	oving in equipment. -entry equipment. Nippled up BOP
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6 30-97 - TIH with 8-	nead on 9-5/8" casing. e on road and location. Start mo nd rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'.
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8-	nead on 9-5/8" casing. e on road and location. Start mo nd rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (bard). Fell through.	oving in equipment. -entry equipment. Nippled up BOP d l drill collar. Tagged up at 7'. . Ran drill collars and tagged up
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st	head on 9-5/8" casing. A on road and location. Start months and rigged up pulling unit and re- a to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through tripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of	oving in equipment. -entry equipment. Nippled up BOP d l drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903' Circulated ou	head on 9-5/8" casing. A on road and location. Start months and rigged up pulling unit and re- as to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through cripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1 theavy contaminated drilling months	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer	head on 9-5/8" casing. e on road and location. Start month and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through cripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1 heavy contaminated drilling month to 3358'. NOTE: Spudded at 8	oving in equipment. -entry equipment. Nippled up BOP d l drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97.
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer	head on 9-5/8" casing. e on road and location. Start month and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through cripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1t heavy contaminated drilling month to 3358'. NOTE: Spudded at 8 crippers to 2	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer 7-1-97 - Continued dr	head on 9-5/8" casing. A on road and location. Start months and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through cripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1 theavy contaminated drilling munths to 3358'. NOTE: Spudded at 8 rilling cement and stringers to 3 cement from 3765-3902'. Circula	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at ated clean. RIH to 4908'. Circulate
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer 7-1-97 - Continued dr 3710'. Drilled hard	head on 9-5/8" casing. A on road and location. Start months and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through tripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1 theavy contaminated drilling munths to 3358'. NOTE: Spudded at 8 rilling cement and stringers to 2 cement from 3765-3902'. Circula and in hole and tagged top of 7" a	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at ated clean. RIH to 4908'. Circulate stub at 5492.55'. Circulated clean.
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer 7-1-97 - Continued dr 3710'. Drilled hard bottoms up Continue	head on 9-5/8" casing. A on road and location. Start months and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through tripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of theavy contaminated drilling munths to 3358'. NOTE: Spudded at 8 filling cement and stringers to 3 cement from 3765-3902'. Circula ed in hole and tagged top of 7" a ruggind complete to the best of my knowledge and belief.	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at ated clean. RIH to 4908'. Circulate stub at 5492.55'. Circulated clean. NTINUED ON NEXT PAGE:
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer 7-1-97 - Continued dr 3710'. Drilled hard	head on 9-5/8" casing. a on road and location. Start months and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through. tripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1 heavy contaminated drilling munths to 3358'. NOTE: Spudded at 8 filling cement and stringers to 3 cement from 3765-3902'. Circula ed in hole and tagged top of 7" a method complete to the best of my knowledge and belief. Operat	<pre>oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at ated clean. RIH to 4908'. Circulate stub at 5492.55'. Circulated clean. NTINUED ON NEXT PAGE: cions Technician</pre>
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer 7-1-97 - Continued dr 3710'. Drilled hard bottoms up Continue I hereby certify that the information above is the sionature Matter Rusty Kleit TYPE OR PRINT NAME Rusty Kleit	head on 9-5/8" casing. a on road and location. Start months of the rigged up pulling unit and rest of the set of my knowledge and belief. a to 1000#. a to 1000#. b to 28' (hard). Fell through. b tripper head and 7-1/16" X 3000 M cridges to 185'. Picked up rest of the avy contaminated drilling munit to 3358'. NOTE: Spudded at 8 cement from 3765-3902'. Circula cement from 3765-3902'. Circula d in hole and tagged top of 7" a me Operat	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at ated clean. RIH to 4908'. Circulate stub at 5492.55'. Circulated clean. NTINUED ON NEXT PAGE: tions Technician July 3, 1997
11" X 3000# weld-on h 6-28-97 - Put caliche 6-29-97 - Moved in an and tested blind rams 6-30-97 - TIH with 8- Drilled plug #1 from at 89'. Rigged up st Washed and drilled br 1903'. Circulated ou 3102' and solid cemer 7-1-97 - Continued dr 3710'. Drilled hard bottoms up Continue I hereby certify that the information above is th skonature TYPE OR PRINT NAME Rusty Kleit (This space for State Use)	head on 9-5/8" casing. a on road and location. Start months and rigged up pulling unit and re- s to 1000#. -3/4" mill tooth bit, bit sub and 7' to 28' (hard). Fell through. tripper head and 7-1/16" X 3000 X ridges to 185'. Picked up rest of 1 heavy contaminated drilling munths to 3358'. NOTE: Spudded at 8 filling cement and stringers to 3 cement from 3765-3902'. Circula ed in hole and tagged top of 7" a method complete to the best of my knowledge and belief. Operat	oving in equipment. -entry equipment. Nippled up BOP d 1 drill collar. Tagged up at 7'. . Ran drill collars and tagged up X 11" 3000 spool. Rigged up swivel. of collars and tubing. Tagged up at ud and cement. Drilled stringer to 8:45 AM 6-29-97. 3463'. RIH and tagged plug #3 at ated clean. RIH to 4908'. Circulate stub at 5492.55'. Circulated clean. NTINUED ON NEXT PAGE: