

Old Ranch Knoll 8 Fed #1 (Cont.)

- 6-3-94: Ran pkr & RBP. Isolated top hole in 5-1/2" at 4187' and bottom
thru hole at 4716'. Holes are communicated to the 9-5/8" casing. Ran
6-9-94 retainer and squeezed bad 5-1/2" csg from 4187' to 4716'. Drilled
out cement to 4720' and test to 500#, ok. No longer communicated
to 9-5/8"
- 6-10-94: Drilled old CIBP @ 7800' & cleaned out to 7912'. Lost returns to
thru old Cisco perfs. Squeezed Cisco perfs w/ 175 sx Cl "C". Cleaned
6-23-94 out to PBD of 8318'. Old Cisco perfs 7856'-8020' are still seeping
some. Ran cmt bond log again. TOC on 5-1/2" is about 3250'.
Squeezed perfs 7856'-8020' w/ 1500 gals Injectrol G. Swab tested
perfs 7856'-8020'. Swabbed dry. Have a slight leak uphole. Prep
to isolate and squeeze uphole leak and then continue with completion
effort.