

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED -
SEP 28 1992

O. C. D.
WORKING PAPER

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

MW Petroleum Corporation

3. Address and Telephone No.

P.O. Box 4628, Houston, Tx 77210

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1650' FNL, 1650' FWL
Section 13F, Township 22S, Range 23E

5. Lease Designation and Serial No.

NM-059077

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

HOC Federal #1

9. API Well No.

30-015-10721

10. Field and Pool, or Exploratory Area

11. County or Parish, State

Eddy County, New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 1) Release pkr. POOH w/ tbg and pkr.
- 2) TIH w/ 5½" CIBP. Set @ 7650'. Dump bail 5 sx cmt.
- 3) TIH w/ 3 1/8" HSC perf gun. Perf squeeze holes @ 5000'-5001' @ 2 SPF.
- 4) TIH w/ 5½" Cmt ret. set @ 4900'. TIH w/ tbg. Sting into retainer.
- 5) Squeeze w/ 75 sx cmt. POOH w/tbg.
- 6) TIH w/ 3 1/8" HSC perf gun. Perf squeeze holes @ 2700'-2701' @ 2 SPF.
- 7) TIH w/ 5½" cmt ret. Set @ 2600'. TIH w/ tbg. Sting into retainer
- 8) Squeeze w/ 75 sx cmt. POOH w/ tbg.
- 9) Spot 10 sx cmt from 100' to surface.
- 10) Cut off and weld on cap.

SEP 23 11 20 AM '92
GAS PRODUCTION
AREA RECORDS
ENGINEERS

RECEIVED

14. I hereby certify that the foregoing is true and correct

Signed W. Wall

Title Sr. Production Engineer

Date 9/15/92

(This space for Federal or State office use)

Approved by _____
Conditions of Use _____

Title _____

Date 9/25/92