

3-22-95 at 6:15 am checked well, tubing had come out of hole 31' and everyting was holding. 7:00am blew down well, rigged up tried to reset packer set packer again held for approximately 5 minutes then came loose again. Called packer people to come out. 9:15 am started out of hole again, 10:am out of hole. packer man started sheer ring had sheered, this was a 50,000lb sheer ring. Packer had no other notable damage. Sent packer in to be checked and new sheer ring put on 60,000lb. 10:30 rigged down secured well.

3-23-95 7:00am rigged up had packer hand and Rice Engineering hand on location and started into hole at 7:35am 9:50am started circulating packer fluid. OCD rep Mike Stebbblefiled on had at this time. 11:30am set packer and pulled 36,000 an pump 300lbs on backside, did not hold. Reset packer at 40,000lb repressured to 300lbs. Held for 20 minutes with no problem also ran chart for OCD. Mike took chart with him. 1:00pm rig down put well back on line and started pumping. Had tally ran on last run and old packer setting was 2589, with new tally packer is now setting at the same 2589.