

1-16-96 Finish going in hole w/spear - came out w/24 joints - run back in hole w/tubing and spear - caught tubing and started pulling and tubing parted 11 joints down. S.D. Tubing @ 9769'.

1-17-96 Ran overshot and used wireline to back of fishing tool. pulled out of hole w/tubing - spear still in stuck tubing. Tubing @ 9769'.

1-18-96 Run in hole w/tubing - unable to screw back into spear - pulled out hole. S.D. Tubing @ 9769'.

1-19-96 Rig up wireline truck. Unable to enter stuck tubing w/cutter - run in hole w/shoe mill to dress top of tubing - cut 3 ft.- tried to run cutter again - unable to enter top of fish - rig down wireline truck - mill 3 more feet. S.D. Tubing @ 9775'.

1-20-96 Rig up wireline truck - unable to enter stuck tubing w/cutting tool - rig down wireline truck - pull mill and tubing - pickup 6 drill collars, bumper sub w/overshot. S.D. Tubing @ 9775'.

1-21-96 Run overshot and fishing tools - overshot kept slipping off stuck tubing - pulled out of hole. S.D. Tubing @ 9775'.

1-22-96 Run in hole w/overshot and drill collars and tubing - Unable to catch fish - come out of hole. Tubing @ 9775'.

1-23-96 Run in hole w/overshot, drill collars jars - caught tubing and recovered 12 joints with spear - layed down bad tubing. S.D. Tubing @ 10,143'.

1-24-96 Run in hole w/overshot, drill collars - came out w/overshot and had a 3'piece of tubing. S.D. Tubing @ 10,143'.

1-25-96 Run in hole w/tubing w/shoe mill, drill collars and bumper sub - drilled 3' with mill in 4 hrs. Tubing @ 10,146'.

1-26-96 Drilled 4' with mill in 6 hrs - pulled out of hole - started overshot w/bumper sub and jars and drill collars in hole. S.D. Tubing @ 10,150'.

1-27-96 Run tubing back in hole and was unable to catch tubing - came out of hole with fishing tools. S.D.

1-28-96 S.D.

1-29-96 Run in hole w/3-3/4" concave mill - unable to mill because of tubing turning under mill - pulled out of hole w/tubing