

18. Pull tubing, drill collars, and bit.
19. Rerun tubing with casing scrapper and recover retrievable bridge plug.
20. Pick up and run production packer on tubing to 9400 ft.
21. Displace well fluid with packer fluid (3% KCl water with corrosion inhibitor) and set packer.
22. Remove B.O.P.'s and install Christmas tree.
23. Swab well to clean up.
24. Put well on stream or stimulate to remove contaminated well fluids.
25. Rig down pulling unit.

RHA:2-19-76