

7. POOH WITH PPI PACKER AND RIH WITH 5" RETRIEVABLE PRODUCTION PACKER AND SET AT 9850'. TEST BACKSIDE TO 500#. ND BOP'S AND NU WELLHEAD ASSEMBLY. BEGIN SWAB TESTING THE STRAWN.
8. ONCE WELL BEGINS TO FLOW, PUT PRODUCTION TO SALES. RD WSU.
9. AFTER 2 WEEKS OF PRODUCTION, OBTAIN OIL, WATER AND GAS ANALYSIS FOR COMPATIBILITY WITH MORROW PRODUCTION.
10. OBTAIN SHUTIN BOTTOM HOLE PRESSURE.
11. ONCE PERMISSION HAS BEEN OBTAINED TO COMMINGLE PRODUCTION, RU WIRELINE AND RETRIEVE PLUG FROM ON-OFF TOOL. RD WIRELINE.