

3-21-74 POOH w/tools & wash pipe, wash pipe drug f/8000-4000' & hit ju markers on outside f/top to btm. Did not rec any junk inside of wash pipe. Went back in ho w/drl collar sub, bumper sub, jars, drl collars & accelerator to 5 stands above fish & SDON. Prep/attempt to screw into collars in hole,

3-22-74 Finished GIH w/top of collars @ 10,933', screwed into collars after moving collars down hole 15', jarred 6½', pld. free & started out of hole w/fish, pld. 36 stands & SDON.

3-23-74 Pulled 5 stands & tbg tongs broke dwn, waited 3 hrs on new tongs. FPOOH, rec'd all of fish, 6 DC's & mill. Rec'd 4 small pieces of junk of top colla. Had 2" x 1" piece of mill missing. WIH w/2-3/8" over shot w/mill guide, bumper sub, jars, 6-3-1/8" DC's, 160 stands tbg. SDON.

3-24-74 FGIH w/over shot. Tagged on cave ins 11,060, washed dwn to 11,088 in 7'. Unable to wash dwn to tbg. Circ hole clean. Pulled 10 stands & SDON.

3-25-74 SD. Prep/ to PDOH & run bit to wash down to top of tbg fish.

3-26-74 POOH w/overshot. Went back in w/3-7/8" bit, bumper sub, jars, 6 DC's & 173 stands of tbg, stopped 3 stands off btm. Installed rotating head & SDON. Prep/wash dn to top of fish @ 11,123'.

3-27-74 Washed out shale cavings dwn to top of tbg fish @ 11,130', 7' lower than previously measured depth to T/fish. Measurements indicate that pkr is 44' below its orig setting depth. POOH w/bit, ran 6 jts wash pipe w/washover shoe, jars, 6 DC's & 89 stands tbg. SDON.

3-28-74 Finished GIH w/wash pipe. Washed over tbg @ 11,130 dwn to on-off tool @ 11,262'. Circ hole clean & POOH. Prep to go in hole w/overshot to fish tbg.

3-29-74 WIH w/overshot. Latched on to tbg & attempted to unlatch seal assembly from pkr. GOOH w/fish @ 3PM. Had injury to one man on crew & SD.

3-30-74 POOH w/c rshot, did not rec fish. WBIH w/overshot extension. Caught fish & jarred for 45 min. SDON. Cost \$144,720.

3-31-74 Jarred on fish for 4½ hrs without pulling loose. Attempt'd to unlatch on-off tool & attempt'd to unscrew seal assembly w/no success. Released overshot & started OOH; pulled 15 stands & SD due to winds.

4-1-74 SD. Prep to finish POOH & run wash pipe to cut over on-off tool & wash dwn to top of pkr.

4-2-74 Finished POOH. Went BIH w/6 jts, w/ 3-13/16 x 3-1/16 washover shoe, jars, DC's & tbg. SD 6 stands off btm. Prep to mill over fish.

4-3-74 Finished GIH w/wash pipe. Washed over tbg from 11,130-11,311; (181') Did not get to on-off tool. Started OOH to pick up more wash pipe. SD due to winds

4-4-74 SD to replace brake blocks on unit. P/to POOH & PU wash pipe.

4-5-74 Replaced air compressor on unit. Pulled 70 stands tbg & SD to work on brakes.

4-6-74 Finished POOH. PU 6 additional jts of wash pipe & WBIH to 11,316' washed dwn to 11,321'. Rec'd shale cuttings. Circ hole clean. Pulled 4 stands & SDON.

4-7-74 Washed dwn to 11,330'. Milled 1½ hrs from 11,330-31½'. Washed dwn to TD 11,394'. Rec'd metal cuttings, sand & glass beads from below 11,330'. Milled 1½ hrs @ 11,394' without making hole. SDON

4-8-74 SD. P/to continue milling

4-9-74 Milled @ 11,394'/3 hrs. POOH w/wash pipe & mill. Mill was completely worn out. Rn 2-3/8" overshot, bumper sub, jars, 6 DC's & 40 stands of tbg. SDON

4-10-74 Finished GIH w/overshot. Latched on to tbg @ 11,130'. Attempt'd to unscrew from pkr & on-off tool. Jarred 3 times & pulled off of fish, caught fish & pulled off 2 more times. COOH w/overshot. Prep to run outside cutter & cut tbg.

RECEIVED
APR 22 1974
U. S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO