

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRI. DATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.
SW835

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such proposals.)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

NM 541580

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
GOVERNMENT T

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT
BURTON FLAT MORROW

11. SEC. T. R. M. OR BLK AND
SURVEY OR AREA

SEC 14 T20S R28E

OIL ☐ GAS ☒ WELL ☐ OTHER

2. NAME OF OPERATOR
OXY USA INC. ✓

3. ADDRESS OF OPERATOR
P.O. BOX 50250 MIDLAND, TX 79710

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

810 FNL 1980 FWL NE-NW

14. PERMIT NO.

300152095800002

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3246

12. COUNTY OR PARISH

EDDY

13. STATE

NM

16. Check Appropriate Box To Indicate Nature of Notices, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

RE-ACTIVATE MORROW

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

REPAIRING WELL
ALTERING CASING
ABANDONMENT*

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and five pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD - 11439' PBTD - 11379 WOLFCAMP-SI - 9206' - 9231' MORROW - 11106' - 11365'

Rigged up on 1/8/93
BAKER LOC-SET PKR @ 10987', BAKER AR-1 PKR @ 9126' W/ X/O ASSB. SET BLK PLG IN PKR ABOVE MORROW.
POOH W/ TBG, REP LEAK, RIH & LATCH INTO LOC-SET PKR, PULL BLK PLG. RIH W/ EQ PRONG & OPEN BYPASS
IN X/O ASSB, SI-ZONES EQ. PULLED X/O IN AR-1 PKR @ 9126', RIH & BLK PLG IN LS PKR @ 10987'. RDWL. MIRU
PUI, KILL WELL, NDWH, NUBOP, RIH & REL AR1 PKR & POOH W/ PKR, X/O & TBG & LAY DOWN. RIH W/ ER RECPT
& 2-7/8" TBG & SET INTO PKR, TEST TO 500#, HELD OK. RIH & PULL EQ PRONG FROM BLK PLG. LET WELL
EQUALIZE. RIH & LATCH ONTO BLK PLG & PULL FROM PROF NIP @ 10987'.

+ Rig down
PUT MORROW ON LINE - FLWD 0-FLUID 135-MCFD IN 34 HRS ON OPEN CHOKE, FTP-45# LP-42#.

on 1/20/93

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

PROD. ACCT.

DATE

04-14-93

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

RECEIVED
APR 15 10 47 AM '93
CARL
AREA 111

J. Lara
1993