

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION
RECEIVED

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

FEB 22 1983

5a. Indicate Type of Lease
State ☐ Fee ☒ XX
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT DEPTH. USE "APPLICATION FOR PERMIT - A" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- 2. Name of Operator C & K Petroleum, Inc. 3. Address of Operator P. O. Box 3546, Midland, Texas 79702 4. Location of Well UNIT LETTER <u>0</u> <u>660'</u> FEET FROM THE <u>South</u> LINE AND <u>1980'</u> FEET FROM THE <u>East</u> LINE, SECTION <u>14</u> TOWNSHIP <u>22S</u> RANGE <u>26E</u> NMPM. 15. Elevation (Show whether DF, RT, GR, etc.) <u>3177' GP</u>	7. Unit Agreement Name 8. Farm or Lease Name Harold Olive Com. 9. Well No. #1 10. Field and Pool, or Wildcat <u>S. 1/4 Sec 14, T22S, R26E</u> 12. County Eddy
--	---

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☒ XX

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Procedure to P&A Well:

- Plug #1: Set CIBP @ 10,050', cmt w/35' cap.
Plug #2: 9800' to 9900', w/35 sx cmt.
Plug #3: 8675' to 8775', w/35 sx cmt.
Plug #4: 8250' to 8350' (at this point 7" csg. will be free pointed and cut off approx. 8300'
This plug will be 50' In & Out, and will be tagged.
Plug #5: 6740' to 6840', w/35 sx cmt.
Plug #6: 5275' to 5375', w/35 sx cmt.
Plug #7: 2200' to 2300' (at this point, 9-5/8" csg will be free pointed and cut off @ approx
2200'). (This cmt plug will be 50' below 13-3/8" shoe & 50' above,
and will be tagged).
Plug #8: 150' to 250', w/25 sx. cmt.
Plug #9: At surface, w/15 sx. cmt and installation of dryhole marker.

NOTE: Hole to be loaded with 10# brine water + 25# gel per bbl.

Post ID-2
3-4-83
P&A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED J. F. Robinson TITLE Production Superintendent DATE 2-21-83
APPROVED BY W. L. Walker TITLE OIL AND GAS INSPECTOR DATE FEB 22 1983
CONDITIONS OF APPROVAL, IF ANY:

Notify H&C of completion to witness
Plugging