. C COPIES	RECEIVED	13		1			Form C		
TRIBU	TION	RECEIVED		PECFIVED	Supersedes Old C-102 and C-103				
T.FE		NEW MEXICO OIL CONSERVATION COMMISSION						ve 1-1-65	
FILE		11	1	Ì					
U.S.G.S.						OCT 1 5 1974	5a. Indicate	e Type of Lease	
LAND OFFICE	Ė						State	Fee X	
OPERATOR		1	1			D. C. C.	5. State Oi	l & Gas Lease No.	
						AGTERIA CEEICE		None	
(DO NOT	USE THIS FO	SL	INDR	Y NOTICES AND R	EPORTS ON	WELLS ACK TO A DIFFERENT RESERVOIR. H PROPOSALS.)			
1.								7. Unit Agreement Name	
WELL OTHER- Dry Hole								NONE 8. Farm or Lease Name	
2. Name of Operator								Moutray	
Southern Union Production Company 3. Address of Operator 1700 Company								·	
1700 Campbell Centre								. 1	
8350 North Central Expressway, Dallas, Texas 75206								and Pool, or Wildcat	
UNIT LETTER H 1980 FEET FROM THE North LINE AND 660 FEET FROM								dcat	
UNIT LETTER	·			PEET PROM, IR		CINE AND FEET			
THE Ea	st	LINE,	SECTI	on 5 town	NSHIP	RANGE	имрм.		
THIND I	IIIIII	III	1111	15. Elevation	n (Show whether	DF, RT, GR, etc.)	12. County		
					3269	GR	Eddy		
16.		Ch	eck	Appropriate Box T		ature of Notice, Report of			
	NOT			NTENTION TO:	o marcute 1		UENT REPORT	r OF:	
		_			ND ABANDON		7	A	
PERFORM REMED	F	=		PLUG AN	ABANDON M	REMEDIAL WORK COMMENCE DRILLING OPNS. X	=	PLUG AND ABANDONMENT	
TEMPORARILY A	7	==		CHANGE	B) ANG	CASING TEST AND CEMENT JOB	╡	PEGG AND ABANDONMENT	
PULL OR ALTER	CASING [CHANGE	PLANS []	OTHER	<u></u>	[-]	
OTHER						STACK			
17. Describe Pr			eted O	perations (Clearly state	all pertinent det	ails, and give pertinent dates, inc	luding estimated d	ate of starting any proposed	
7/26/74 7/28/74									
8/4/74	Set 8 - 5/8" 24# & 28# casing @ 1900' RKB w/750 sx Halco Lite w/1/4# Flocele and 5# Gilsonite/Sk, followed w/150 sx Class "C" w/2% CC. Circulated cement. Pressure tested to 1000 PSI with rig pumps.								
9/18/74	Plugged for abandonment: #1 @ 9600'-9500' w/35 Sx C;ass "H" neat; #2 @ 9200'-9100' w/35 sx Class H Neat; #3 @ 7225'-7125' w/35 sx Class H Neat; #4 @ 5100'-5000' w/35 sx Class H Neat; #5 @ 3600'-3500' w/35 sx Class H Neat; #6 @ 1850'-1950' w/35 Class H Neat; #7 @ 10'-0' w/5 sx Class H Neat. Cut off 8-5/8" casing and weld 3/8" plate and marker.								
18. I hereby cen	that the	e info	rmatio	n above is true and come		of my knowledge and belief. anager, Drilling & P	roduction ^{re} -	10/7/74	
	/ E-00		2	1	_			OCT 23 1974	